

COMPLAINT

SECONDARY COMPLAINTS

2-3, 3-2 shift concern

- 3-2 neutral
- Harsh 3-2 coast down shift
- 2-3 flare
- 2-3 neutral

CAUSE

Bore wear causes the valve to stick and excessive end plug leakage alters valve timing.

CORRECTION

Valve hang-up is eliminated by reaming the bore and installing the Sonnax oversized valve, spring and end-plug. Valve timing is restored by reducing excess end plug leakage.

B4 Release Valve Kit

59947-26K

- 1 Release Valve
- 1 Spring
- 1 End Plug




F-59947-TL26

- 1 Reamer
- 1 Guide Pin
- 1 Reamer Jig



Note: For information on proper vacuum test procedures, go to www.sonnax.com, click on "Technical Information" and go to Vacuum Testing Guidelines Instructions.

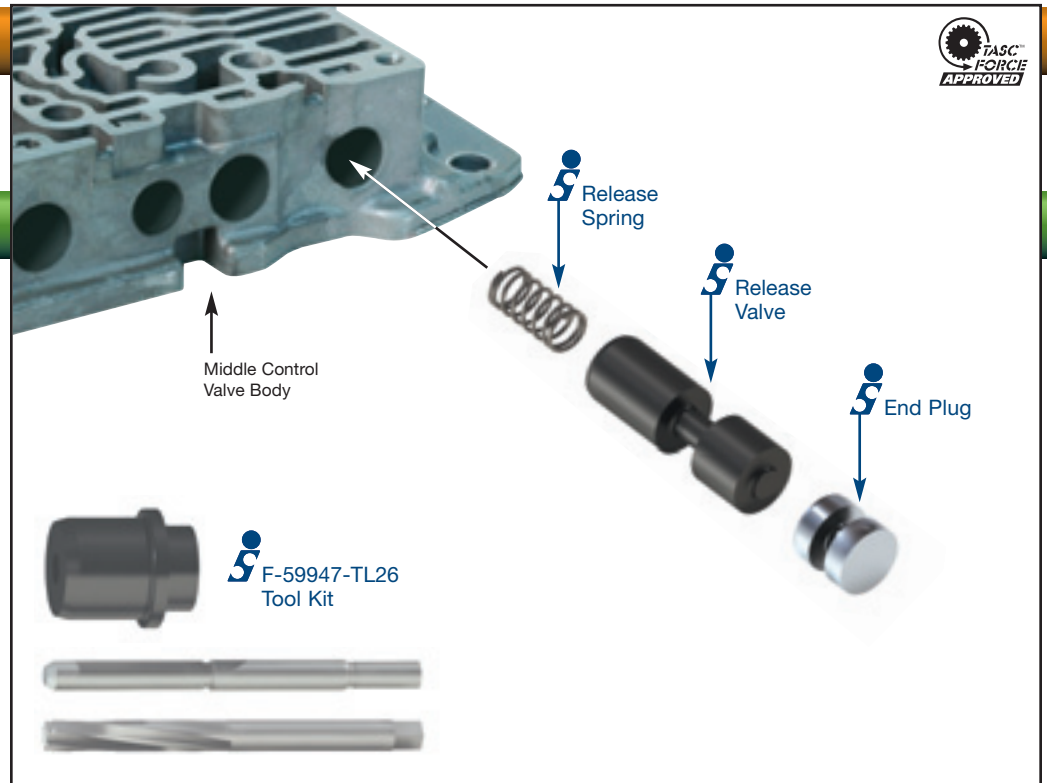

Features & Benefits

- Recalibrated spring restores OEM shift quality.
- Restores hydraulic integrity.
- Hard coat anodized valve for increased durability.
- Addresses a multitude of shift concerns.
- Salvages valuable core.

You need this if...

Vacuum tests at the ports indicated do not hold 18" or more.

