

COMPLAINT

SECONDARY COMPLAINTS

3-2 control valve spring breaks

- 3-2 bind • 2-4 band overheat

CAUSE

Fatigue from 3-2 control valve operation.

CORRECTION


Replacement spring salvages valve bodies and prevents 3-2 bind or 2-4 band overheat.

3-2 Control Valve Spring

77754-23

1 3-2 Control Valve Spring

Note: This spring works only in 1996 and later on/off- style 3-2 control valve bodies. It will not work in 1993-95 PWM-style 3-2 control valve bodies.

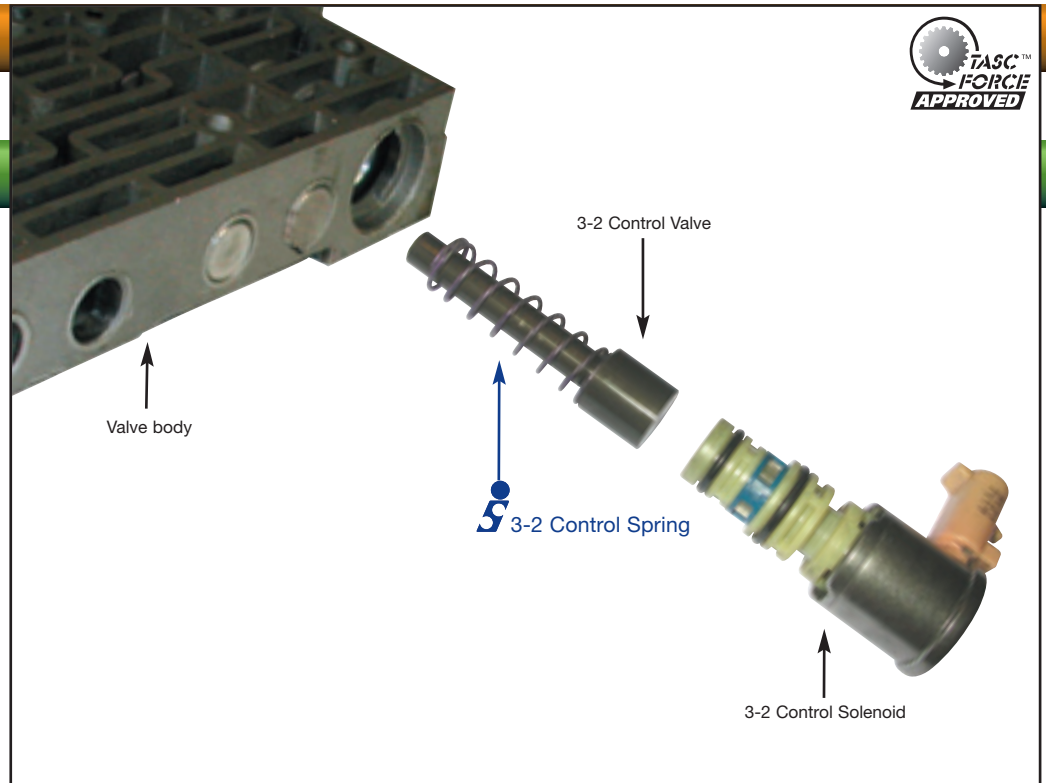

Sonnax Part Summary

The 3-2 control valve spring in late-model 4L60-E and 4L65-E valve bodies often breaks, and can cause a 3-2 bind and/or 2-4 band to overheat. This spring is often found to be broken during valve body service, and OEM replacements are not available. Sonnax now offers a replacement spring 77754-23 for '96 and up 4L60-E and 4L65-E units.

Features & Benefits

- Inexpensive replacement for unavailable OEM spring.
- Salvages valve body core.