# 46RH/RE A727 & 47RH/RE

Part Numbers 22900-10, 22900-15

### COMPLAINT

### No reverse or slip after low/reverse drum resurfacing

## CAUSE

OEM strut of insufficient length to adequately hold drum after resurfacing

# CORRECTION

These extended length struts compensate for material removed by machining when used drums are salvaged by machining the outer diameter.


# Oversized Band Strut

22900-10

1 Oversized Band Strut, .100"

### 22900-15

1 Oversized Band Strut, .150"

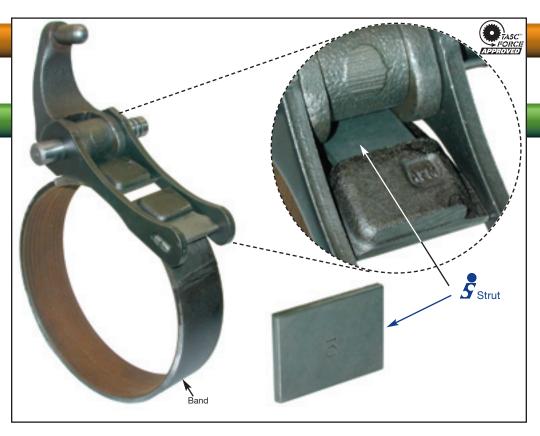

#### **Sonnax Part Summary**

After the low/reverse brake drum has been resurfaced and the brake band has been relined, the band may not hold during apply, causing a slip or no reverse. Sonnax has designed two extended struts, **22900-10** and **22900-15** to address these problems..

#### **Features and Benefits:**

- 22900-10 is .100" longer and 22900-15 is .150" longer to regain correct band adjustment.
- Use of these struts eliminates the need to use specially relined bands with a thicker lining.

