

COMPLAINT

Overdrive planetary failure

CAUSE

A melted front lube/drainback valve restricts the lube oil feed circuit in the stator.


CORRECTION

The replacement aluminum ball seat and ball seat stop will not melt.

Front Lube/ Drainback Valve

36425-01K

1 Front Lube/Drainback
Valve Assembly
1 Cup Plug

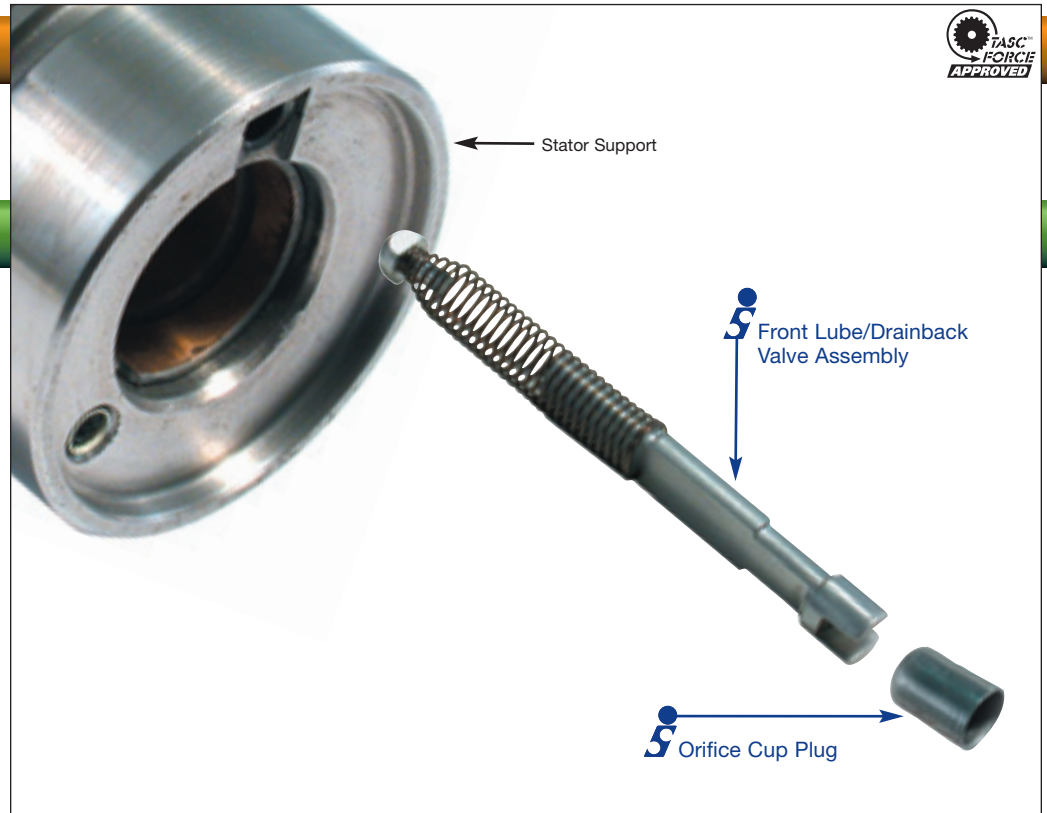

Sonnax Part Summary

The OEM plastic front lube/drainback valve assembly can melt at elevated fluid temperature. Once the plastic ball seat or ball seat stop melts it can restrict the front lube oil feed circuit, resulting in overdrive planetary failure. Sonnax offers an improved front lube/drainback valve assembly **36425-01K**.

Features & Benefits

- Ball seat and stop are manufactured from high-quality aluminum to withstand elevated fluid temperatures and prevent melting.
- Ensures integrity of the front lube oil feed circuit.

Save

\$100 in costly overdrive planetary failure