

## COMPLAINT

Forward clutch failure and poor lube oil flow

## CAUSE

Leakage between center support and hub from insufficient number and staggered spacing of mounting screws, surface finish flaws, and flatness defects.

## CORRECTION

This center support gasket eliminates leakage between the center support and the hub.

### Center Support Gasket

**36743G** '89-up  
5 Gaskets

**Note:** US Patents 6,325,388, 6,588,766 & 7,097,178


Also Available:

**36743H** Early Model

**36743H-01** Late Model ('95-up)

Each includes the following  
Center Support Hub/Bearing Type

**96423-01** (works with 36743H-01)  
1 Center Support Bearing

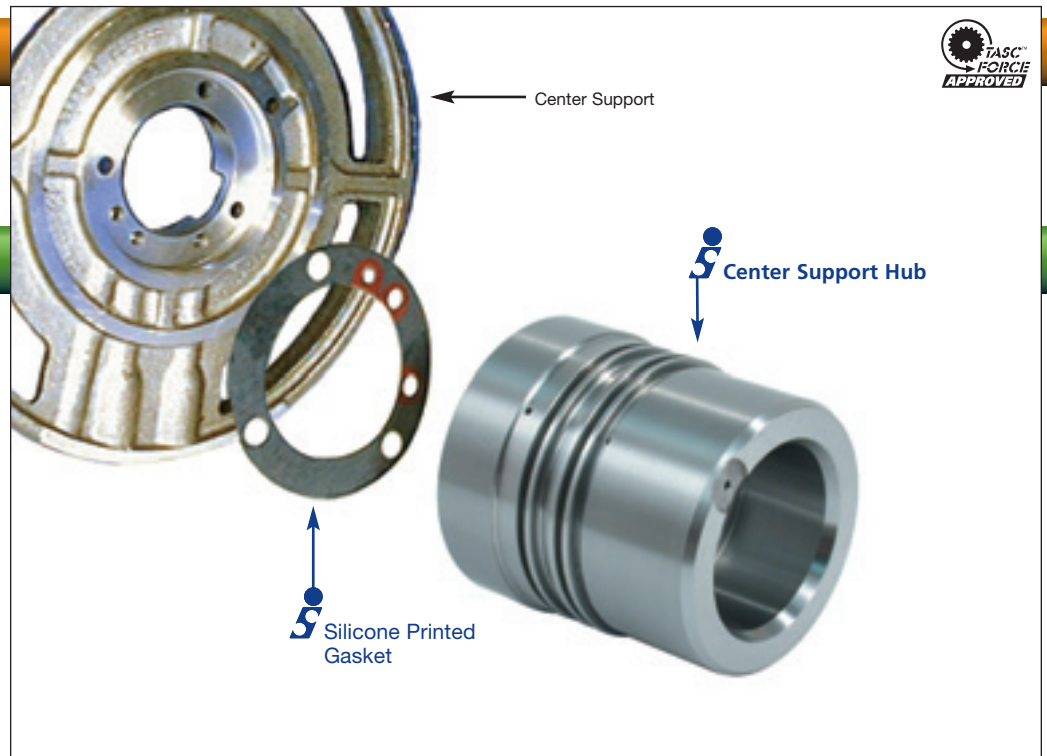

### Sonnax Part Summary

In Ford E4OD units, leakage between the center support and hub can cause forward clutch failure and/or poor lube oil flow. This leakage can be caused by a number of problems, including an insufficient number and staggered spacing of mounting screws, surface finish flaws and flatness defects. Install Sonnax E4OD center support gasket **36743G** to alleviate these problems.

### Features & Benefits:

- Center support gasket has a printed silicone bead to fill in any gaps between the center support and hub.