

COMPLAINT

SECONDARY COMPLAINT

Low line pressure and TCC concerns

- Converter code 1744 or overheat code 1783

CAUSE

Main pressure regulator valve bore wear.

CORRECTION

Oversize the bore with the Sonnax tool kit and install the Sonnax oversized pressure regulator valve kit with spring sleeve and custom spring.

Pressure Regulator Valve Kit

36940-03K

- 1 Pressure Regulator Valve
- 1 Spring Sleeve/End Plug
- 1 Spring




F-36940-TL3

- 1 Reamer
- 1 Reamer Jig
- 1 Guide Pin



Note: A specially designed oversized base plate **VB-06** must be mounted to the **VB-FIX** to accommodate the 5R110W pump body.

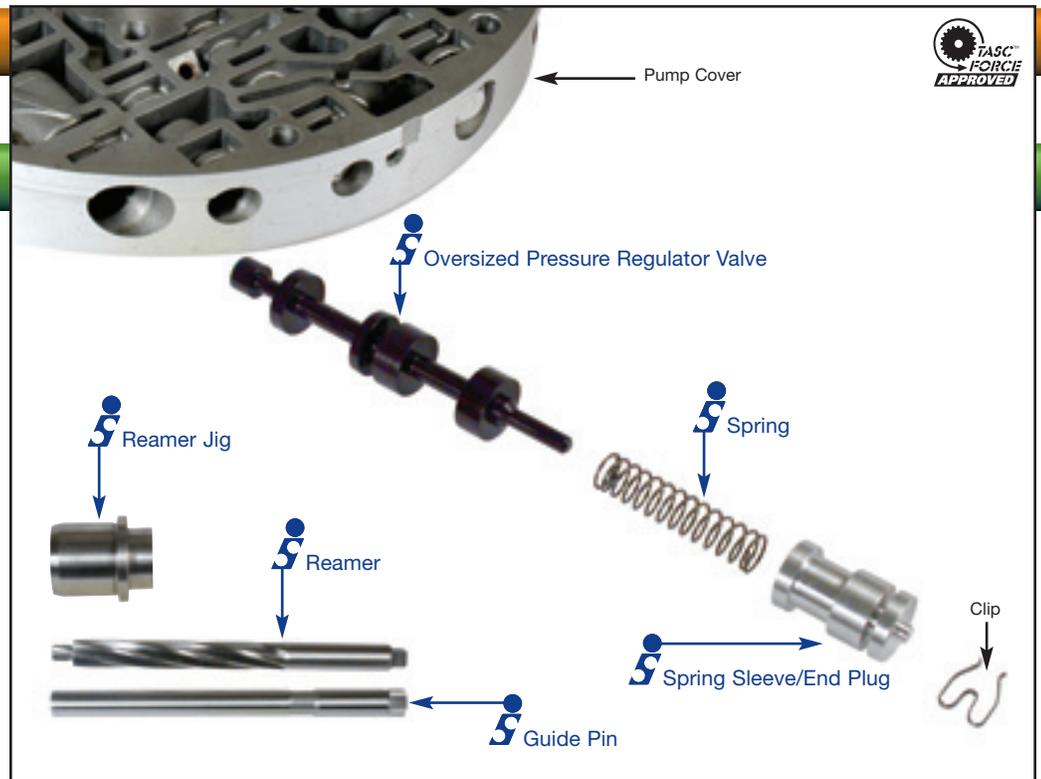


Features & Benefits

- Salvages pump bodies with worn pressure regulator valve bores.
- Restores normal line pressure, eliminates related shift problems and restores cooler flow.
- Repairs both early and late versions of 5R110W pump bodies.

You need this part if ...

A Wet Air Test at the balance end circuit and at the LPC/PCA solenoid circuit at the locations indicated results in leakage at the neighboring ports, or if a vacuum test at these two locations gives less than 18" of vacuum.

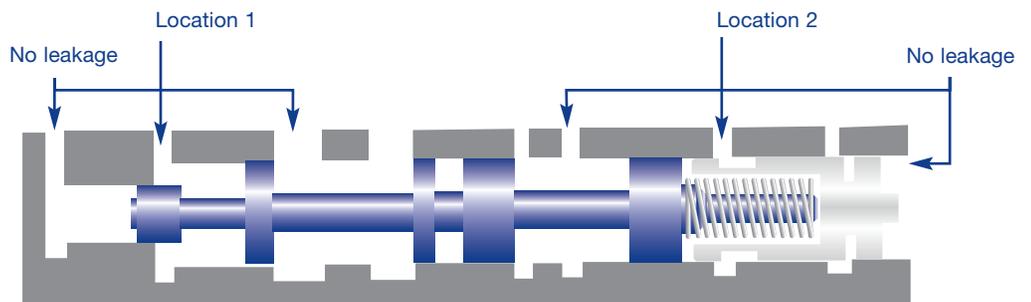

For more information about valve body testing procedures, go to www.sonnax.com.