

COMPLAINT

SECONDARY COMPLAINT

Reduced line pressure, Delayed drive/reverse engagement

- Loss of valve body core

CAUSE

Valve and/or bore wear due to linkage side loads and/or extended service life.

CORRECTION

Ream the bore oversize and install oversized manual valve.

Oversized Manual Valve


36940-11

1 Oversized Manual Valve



F-36940-TL11

1 Reamer
1 Reamer Jig
1 Guide Pin

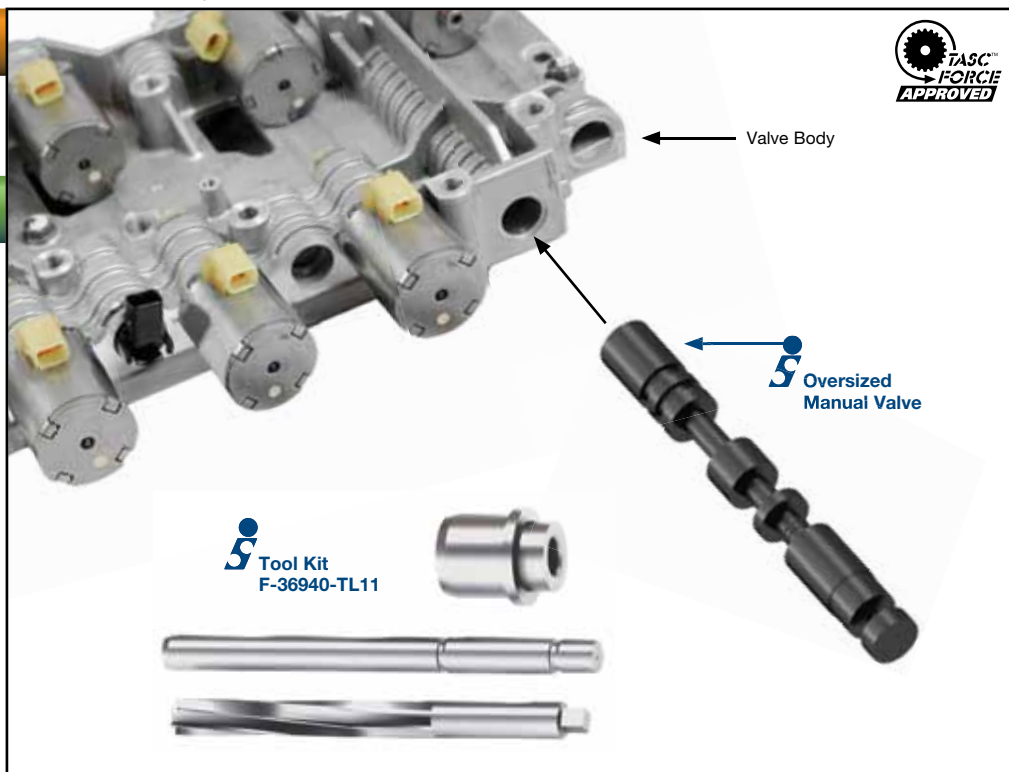

Features & Benefits

- Salvages valuable valve bodies.
- Restores OE manual valve function.
- Sonnax hard anodized aluminum valve maintains tight bore/valve clearances after thermal expansion.
- Simple reaming process keeps work in-shop.

You need this if...

A visual inspection indicates wear at the Low/Reverse clutch circuits (the land between the two most outboard circuits), or wear at the Line Pressure/Direct Clutch circuits (the land between the two most inboard circuits). Obvious wear of the valve spools at the locations discussed above indicates wear in the bore.