

COMPLAINT

SECONDARY COMPLAINT

Damaged/cracked accumulator plate

- Plate not available separately from OEM

CAUSE

The OEM plate flexes, causing the screws to loosen and break.

CORRECTION

The Sonnax replacement plate is made from stronger, thicker steel and has three additional screw holes and stronger screws to ensure the plate is held securely.

Accumulator Cover Plate

44892-01K

- 1 Accumulator Plate
- 1 Shim (large washer)
- 6 Screws
- 6 Washers

Patent pending




44892-TL

- 1 Thread Tap

Notes: The 44892-TL tap is required to meet Sonnax-recommended torque specifications.

We also suggest that the solenoid switch valve plugs be inspected or replaced with **92835-02K** (standard size) or **92835-18K** (oversized).

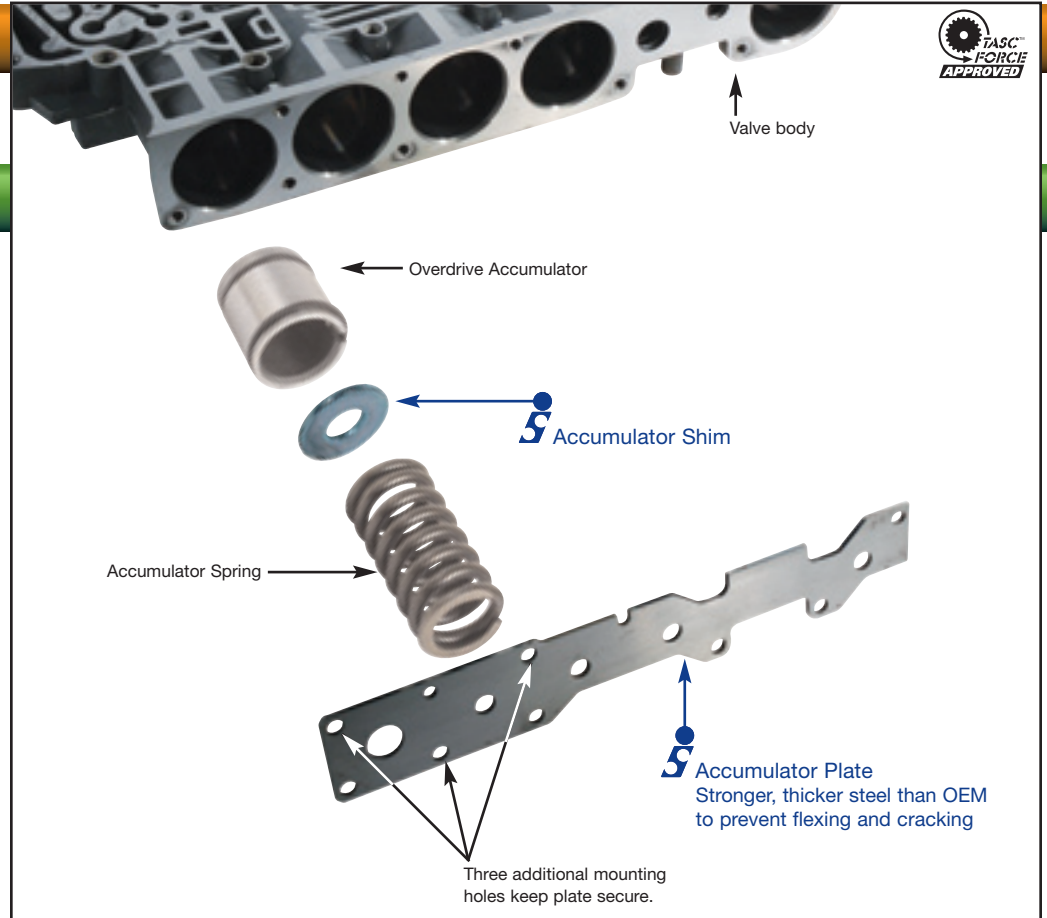

Sonnax Part Summary

The accumulator plate in 45RFE and 545RFE units is weak and not held securely enough to withstand the action of the accumulator pistons. The OEM plate flexes, causing the screws to loosen and break. The Sonnax improved accumulator plate **44892-01K** is an upgrade over the OEM plate and allows salvage of valve bodies with damaged plates. The plate is made of thicker steel and has three additional screw holes to hold the plate more securely. The 44892-TL thread tap forms stronger threads in the aluminum valve body.

Features & Benefits

- Accumulator plate is made from stronger, thicker material to prevent flexing.
- Three additional mounting holes and high torque-rated screws prevent the plate or screws from coming loose from normal vibration.
- Specially graded tap provides higher torque yield threads.