

COMPLAINT

SECONDARY COMPLAINT

Front seal leak

- Poorly fitting standard replacement bushings

CAUSE

Normal wear and tear; replacement aftermarket bushings are too loose.


CORRECTION

Replace the worn bushing with this new more tightly tolerated bushing.

Improved Bell Housing Bushing

54253-01

1 Bell Housing Bushing

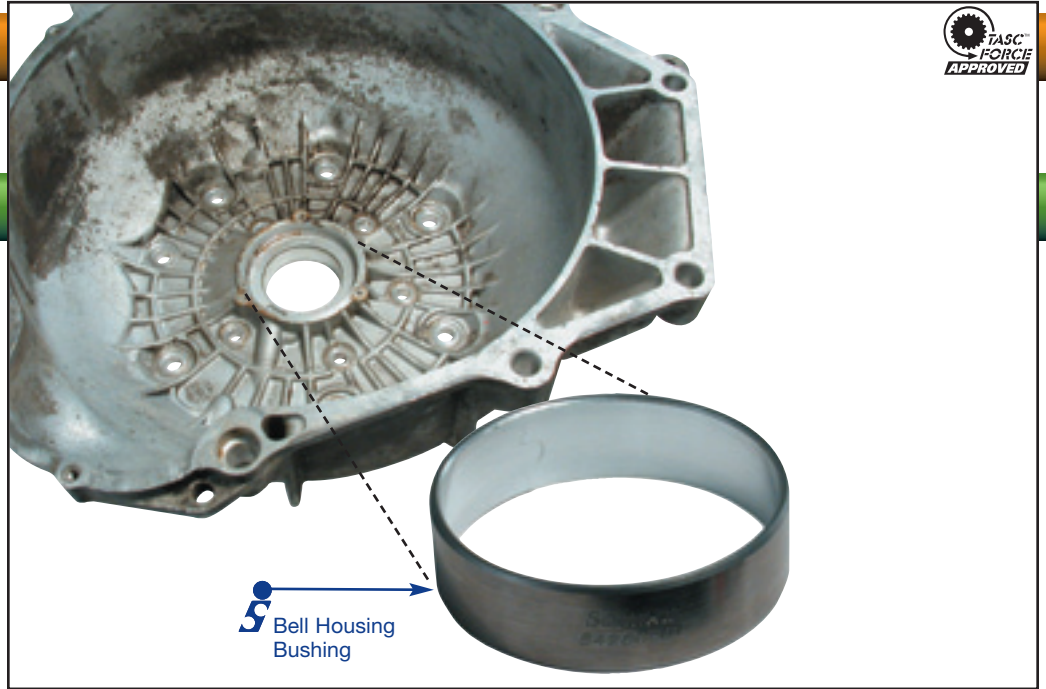

Sonnax Part Summary

The bell housing bushing on the 4L30-E & 180C transmissions becomes worn due to normal wear. Excessive clearance between the bell housing bushing and the converter hub will cause a front seal leak. Simply replacing the metal-clad seal will not fix the problem. Current aftermarket bushings do not fit the converter hub tightly enough and can have more clearance than a worn OEM bushing. The new Sonnax bell housing bushing **54253-01** is designed to fit the converter hub properly and eliminate front seal leakage.

Features & Benefits

- More tightly tolerated than aftermarket bushings.
- Prevents costly bell housing replacement.