

## COMPLAINT

SECONDARY COMPLAINTS

## Worn accumulator piston pin bore or damage from broken spring

- 3rd clutch distress
- Soft 2-3 upshift or 4-3 kickdown

## CAUSE

Normal wear and uneven loading from spring.

## CORRECTION

Install the Sonnax replacement piston with increased bore length for more piston-to-pin support and greater durability.

## 2-3 Accumulator Piston

### 72871-01

1 Accumulator Piston


Also Available

### 72872-01

1, 3-4 Accumulator Piston

#### NOTES:

- This piston should not be used in a first-design 2-3 accumulator found in 1993 models. These units do NOT have the second “bumper spring” on the top portion of the accumulator piston.
- If the large spring is broken, replace with GM part number 8684827

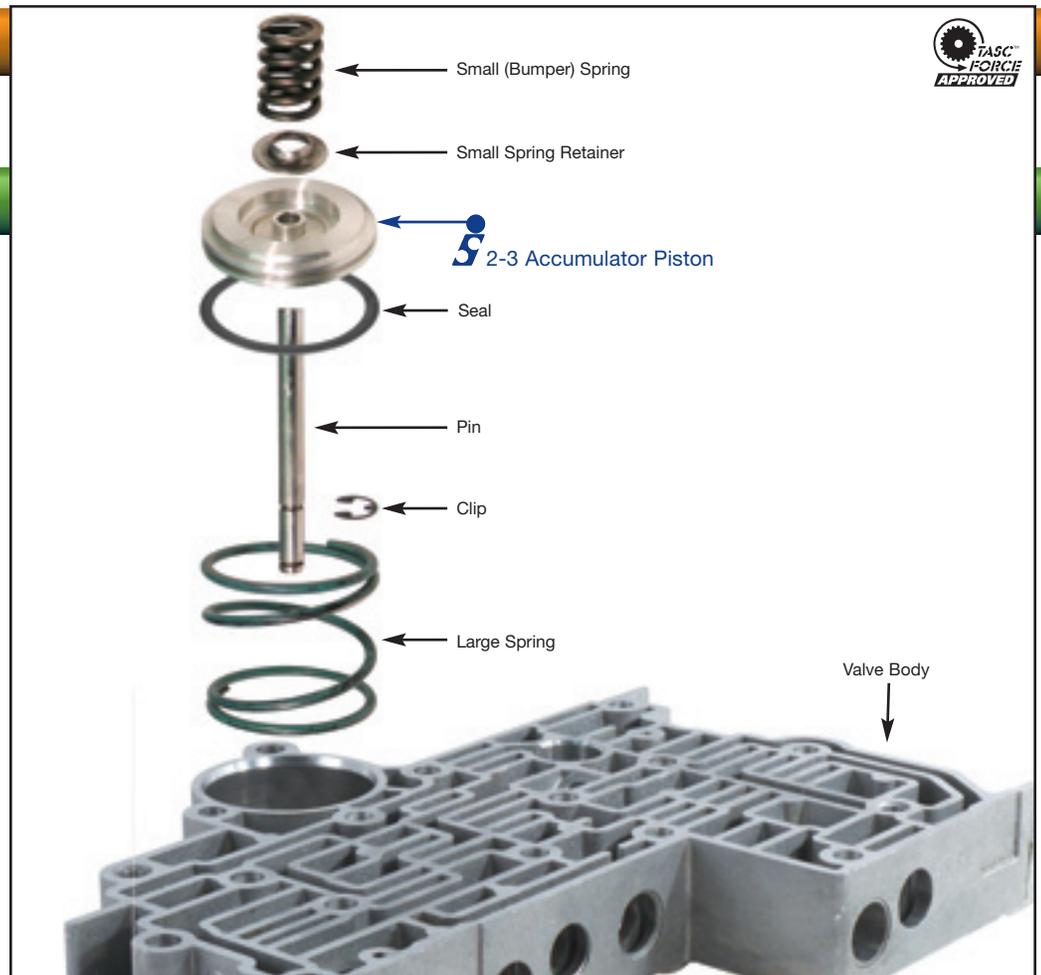

#### Sonnax Part Summary

The piston bore in 4T80-E units is prone to wear, either through normal operation or uneven loading from the spring. The Sonnax replacement piston **72871-01** provides more piston-to-pin support and greater durability than OEM replacements.

#### Features & Benefits

- Increased bore length for more piston-to-pin support.
- Machined from high-quality aluminum.
- More durable than OEM replacements.
- Piston accepts standard OEM or replacement seals.