

COMPLAINT

SECONDARY COMPLAINTS

3-4 clutch/band failure

- Poor line rise • Soft shifts

CAUSE

The TV cable is out of adjustment.


CORRECTION

This shorter TV link ensures readjustment of the throttle cable and was designed with the carry-out unit in mind.

Shortened TV Link

77872-01

5 TV Links

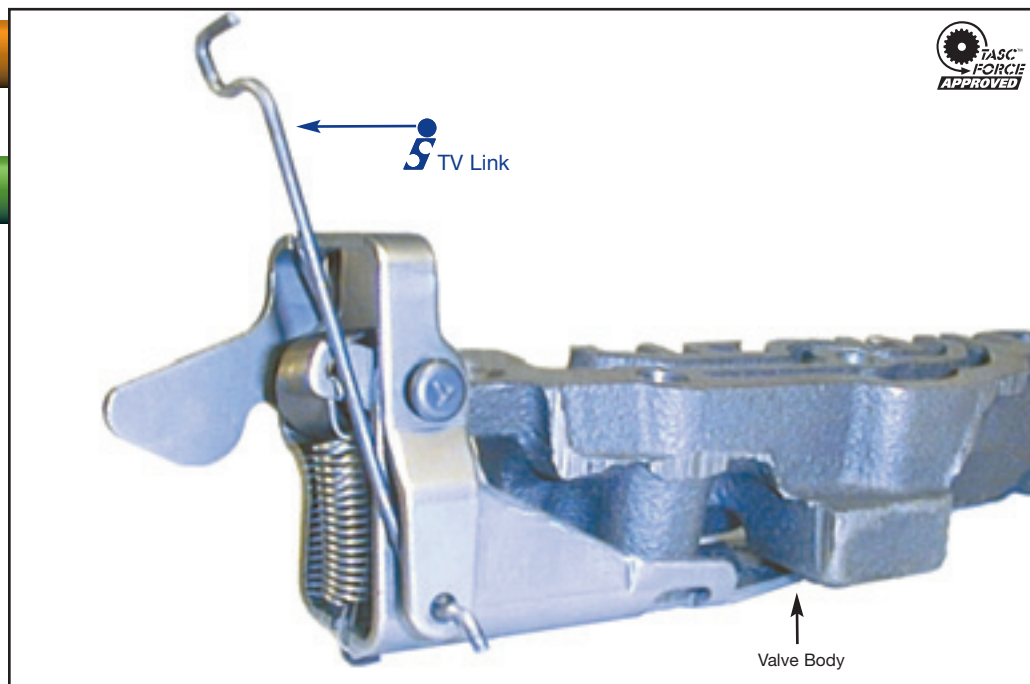

Sonnax Part Summary

The TV cable synchronizes engine throttle movement with TV plunger movement. If the cable is not readjusted to ensure proper line rise, the unit may return quickly with soft shifts and a burned 3-4 clutch or band. Sonnax has designed a throttle valve link **77872-01** that is shorter than the OEM, so that the installer must readjust the TV cable.

Features & Benefits

- This shortened link was designed with the “carry-out” unit in mind.
- Prevents unit failure after rebuild.