# 41TE, 42LE

**PART NUMBER 92835-07** 

## COMPLAINT

SECONDARY COMPLAINTS

## CAUSE

A worn pressure regulator reducing sleeve allows oil leakage.

## Correction

This replacement pressure regulator reducing sleeve eliminates oil loss and cross leakage.


### Pressure Regulator Reducing Sleeve

#### 92835-07

1 Pressure Regulator Sleeve

### High line pressure, erratic converter apply pressure

• Poor lube control • Harsh shifting

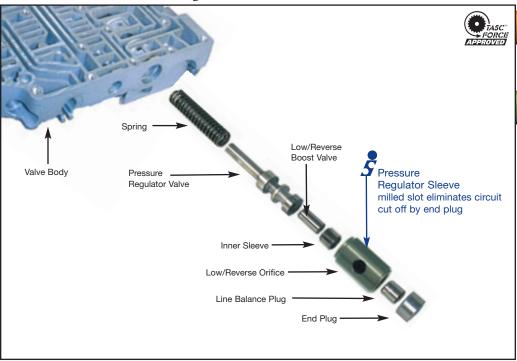

### **Sonnax Part Summary**

Many 41TE/42LE transmissions experience erratic line pressure which creates lube and converter clutch concerns, as well as harsh shifting. These complaints are often caused by a worn pressure regulator reducing sleeve. Sonnax now offers a replacement pressure regulator sleeve **92835-07** to prevent excessive wear.

#### **Features & Benefits**

- Sleeve is made of hard-coat anodized aluminum to resist wear.
- Tight tolerances eliminate oil loss and cross leakage.
- The sleeve has been improved over OEM to prevent incorrect positioning and eliminate circuit cut-off.

