PART NUMBER 85110-01K

## Complaint

Delayed engagement

SECONDARY COMPLAINT

## CAUSE

Sealing ring leaks forward clutch oil.

# Correction


The Sonnax steel-backed bushing and sealing ring restore forward clutch oil pressure.

### F-Clutch Drum Bushing & Sealing Ring Kit

85110-01K

1 Sealing Ring 1 Bushing

Note: Fits early bushing-style ZF5HP19.

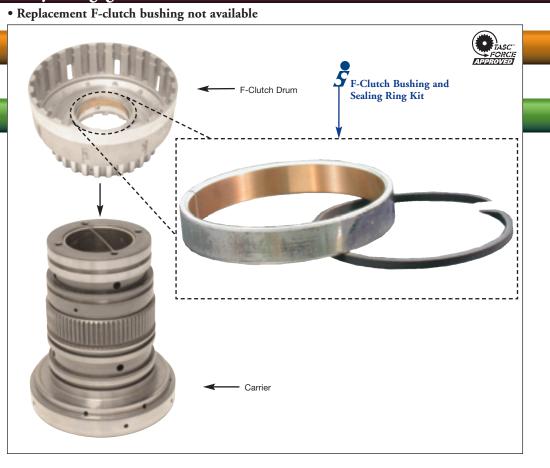

### Sonnax Part Summary

The OEM sealing ring cuts a groove into the F-Clutch drum bushing and reduces the sealing ability of the seal and bushing.

#### Features & Benefits

- Bushing and sealing ring now available separately, enabling salvage of drum.
- Steel-backed bronze bushing is OEM equivalent.
- Kit restores hydraulic integrity to clutch circuit, preventing loss of forward clutch oil.

