

Aisin AW 55-50SN*

*Also fits AW55-51SN, AF 23/33 & RE5F22A

sonnax®

TIME TESTED • INDUSTRY TRUSTED®

1 Automatic Drive • P.O. Box 440 • Bellows Falls, VT 05101-0440 USA
(800) 843-2600 • (802) 463-9722 • F: (802) 463-4059 • www.sonnax.com

Click on Sonnax part numbers to see more information.

1 59947-01K Lockup Relay Control Valve Kit

Helps cure:

- TCC apply & release problems
- Inadequate lubrication

2 59947-77K Oversized Lockup Control Valve Kit

Helps cure:

- Burnt converter
- Delayed/No lockup

Note: Requires tool kit F-97741-TL20, & the VB-FIX reaming fixture.

3 59947-03K Lockup Control Valve Kit

Helps cure:

- TCC apply & release problems
- Converter codes

4 59947-05K Solenoid Relay Valve Kit

Helps cure:

- No TCC apply
- Shift concerns

5 59947-29K Oversized Lockup Control Valve & Boost Valve Kit

Helps cure:

- Harsh downshifts
- RPM surging on coast/light acceleration

Note: Requires tool kits F-59947-TL29, F-15741-TL29PL & the VB-FIX reaming fixture.

6 59947-12K Oversized Pressure Regulator & Boost Valve Kit

Helps cure:

- Wear at the main PR valve bore
- Harsh/Soft shifts

Note: Requires tool kit F-59947-TL12 & the VB-FIX reaming fixture.

7 59947-07K Boost Valve Kit

Helps cure:

- Delayed engagements
- Harsh/Soft shifts

8 59947-34K Oversized Solenoid Modulator Valve Kit

Helps cure:


- Low line pressure
- Delayed Forward

Note: Requires tool kit F-59947-TL34 & the VB-FIX reaming fixture.



Zip Kit®
AW55-50SN-ZIP

This Sonnax kit also is available, see www.sonnax.com for details.

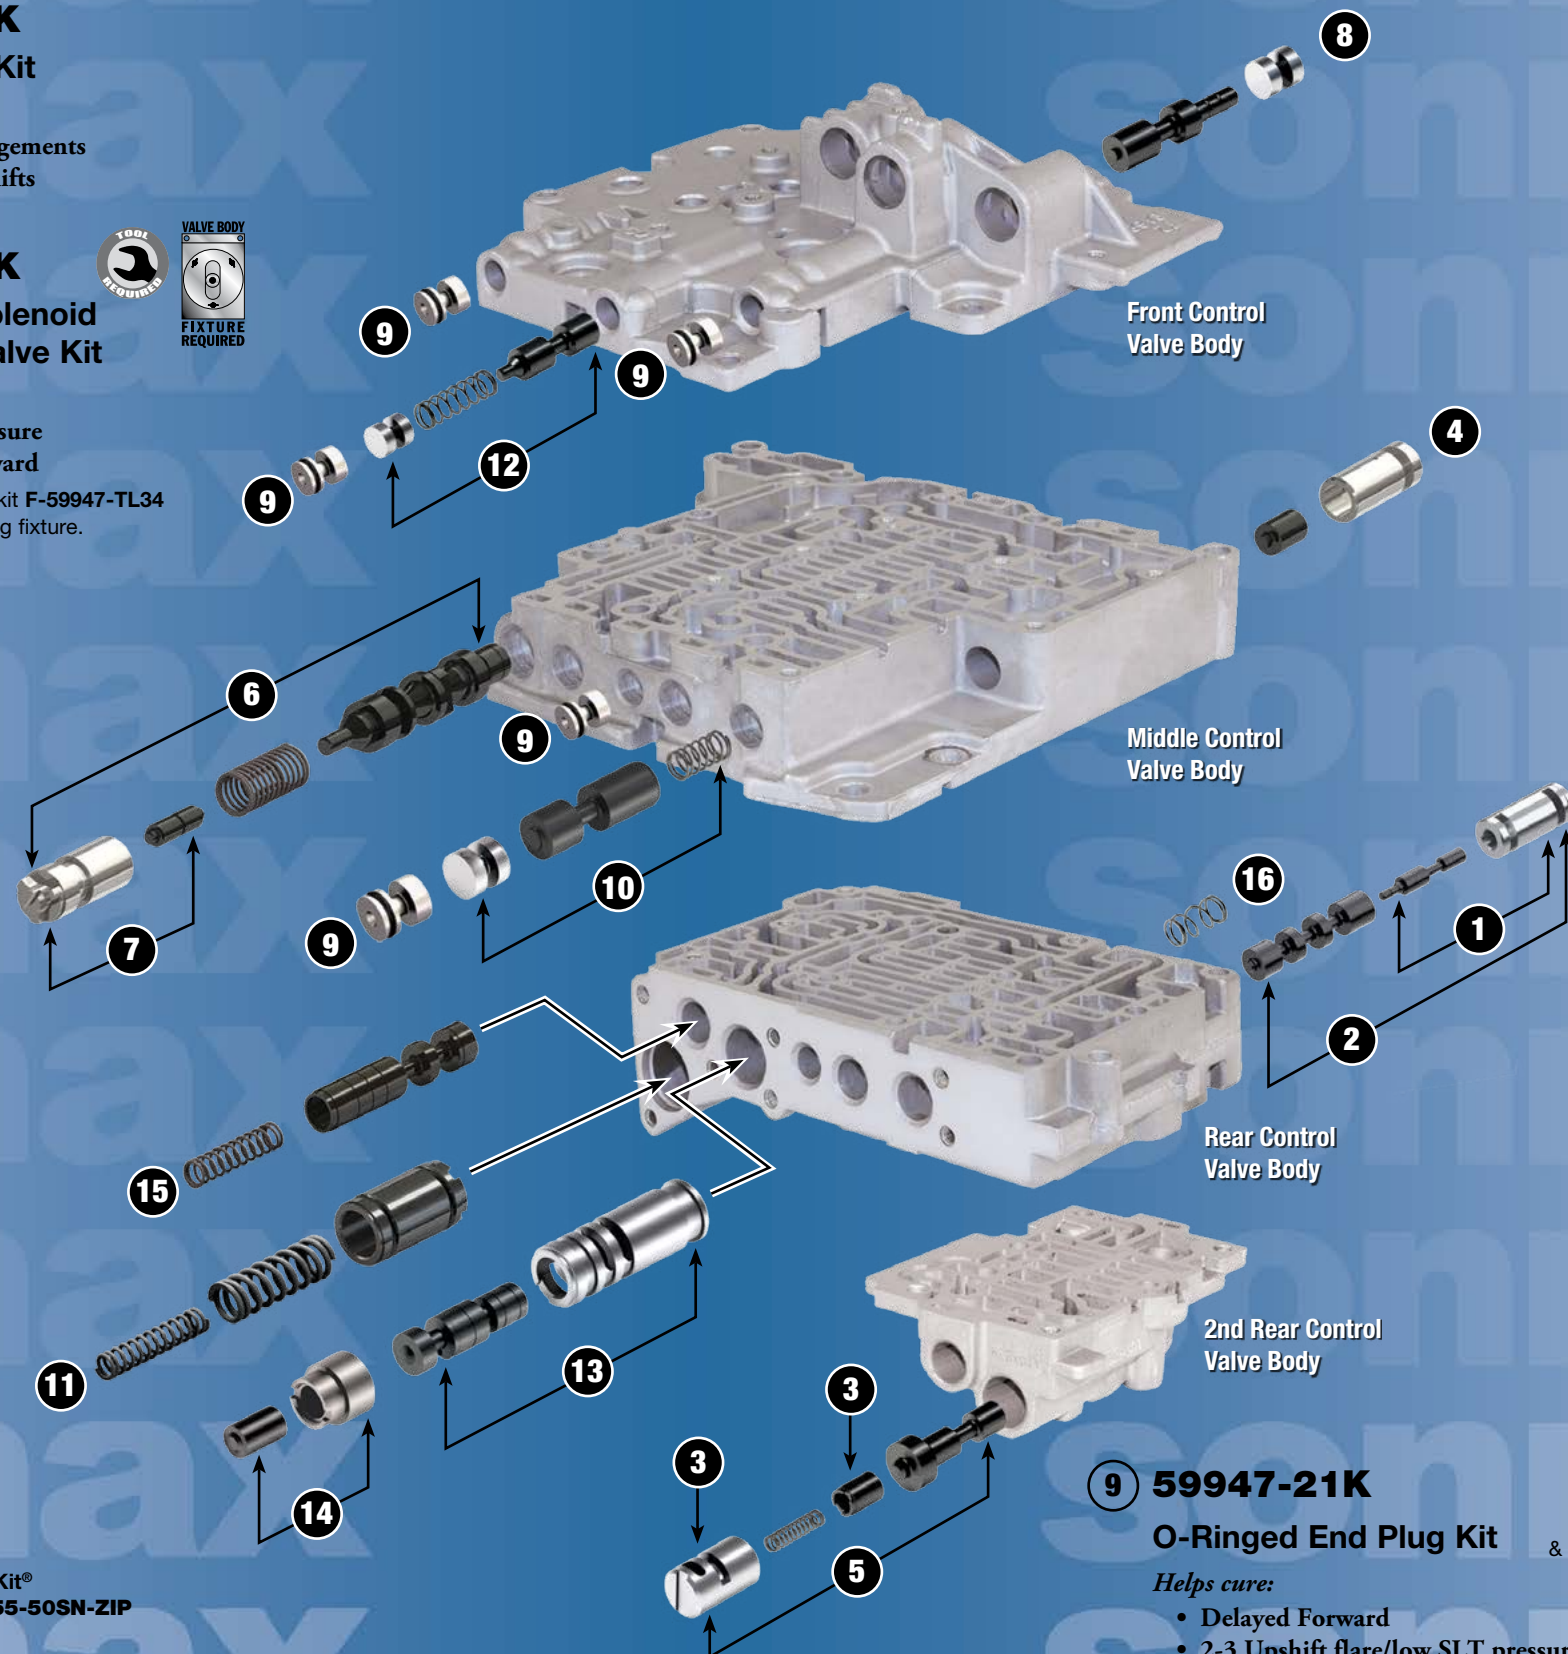

9 59947-21K O-Ringed End Plug Kit

Helps cure:

- Delayed Forward
- 2-3 Upshift flare/low SLT pressure

4 Small
& 1 Large

10 59947-26K Oversized B4 Release Valve Kit

Helps cure:

- 2-3, 3-2 Shift concerns
- 3-2 Neutral

Note: Requires tool kit F-59947-TL26 & the VB-FIX reaming fixture.

11 59947-LPC LPC Accumulator Piston Kit

Helps cure:

- Delayed Forward
- Low line, lube & converter pressure

12 59947-35K Oversized Neutral Relay Valve Kit

Helps cure:

- Delayed Forward
- Increased throttle required for engagement

Note: Requires tool kit F-59947-TL34 & the VB-FIX reaming fixture.

13 59947-38K Shift Pressure Control Valve Kit

Helps cure:

- Various harsh shift concerns
- Various burnt clutches

14 59947-75K Shift Pressure Control Plunger Valve Kit

Helps cure:

- Harsh shifts
- Burnt clutches

15 59947-16K Oversized Secondary Regulator Valve Kit

Helps cure:



- Overheating of fluid, bushing & converter
- Harsh Reverse

Note: Requires tool kit F-59947-TL16 & the VB-FIX reaming fixture.

16 59947-33 B5 Control Spring

Helps cure:

- Incorrect valve body calibration

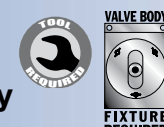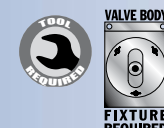

5/Bag

©2016 Sonnax Industries, Inc.

The Sonnax products listed here may be protected by one or more patents, or be patent pending.