

Chrysler

45RFE, 545RFE, 65RFE, 66RFE, 68RFE

sonnax®

TIME TESTED • INDUSTRY TRUSTED®


1 Automatic Drive • P.O. Box 440 • Bellows Falls, VT 05101-0440 USA
(800) 843-2600 • (802) 463-9722 • F: (802) 463-4059 • www.sonnax.com

1 92835-02K .420" OE Dia Spool Solenoid Switch Valve Plug Kit


Helps cure:

- Erratic/No TCC
- 2nd Gear Starts
- Low/Reverse switch code

2 92835-31K .453" OE Dia Spool Oversized Solenoid Switch Valve & Plug Kit

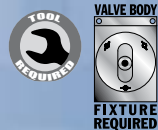

2 92835-32K .420" OE Dia Spool Oversized Solenoid Switch Valve & Plug Kit

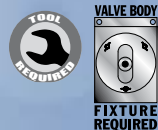

Helps cure:

- Failsafe mode
- Codes 841, 868, 871, 988, 1775, 1776
- OD clutch burned

Note: 92835-32K Requires tool kit F-92835-TL32;
92835-31K requires tool kit F-92835-TL31 & they
both require the VB-FIX reaming fixture.

3 92835-22K .453" OE Dia Spool Oversized Solenoid Switch Valve Plug Kit



Helps cure:

- Erratic/No TCC
- 2nd Gear Starts
- Low/Reverse switch code

Note: 92835-22K Requires reamer 92835-RM22.


4 44912-08K Oversized TCC Switch Valve Kit




Helps cure:

- No lockup
- TCC slip & codes
- TCC apply & release concerns

Note: Requires tool kit F-44912-TL8 & the
VB-FIX reaming fixture.

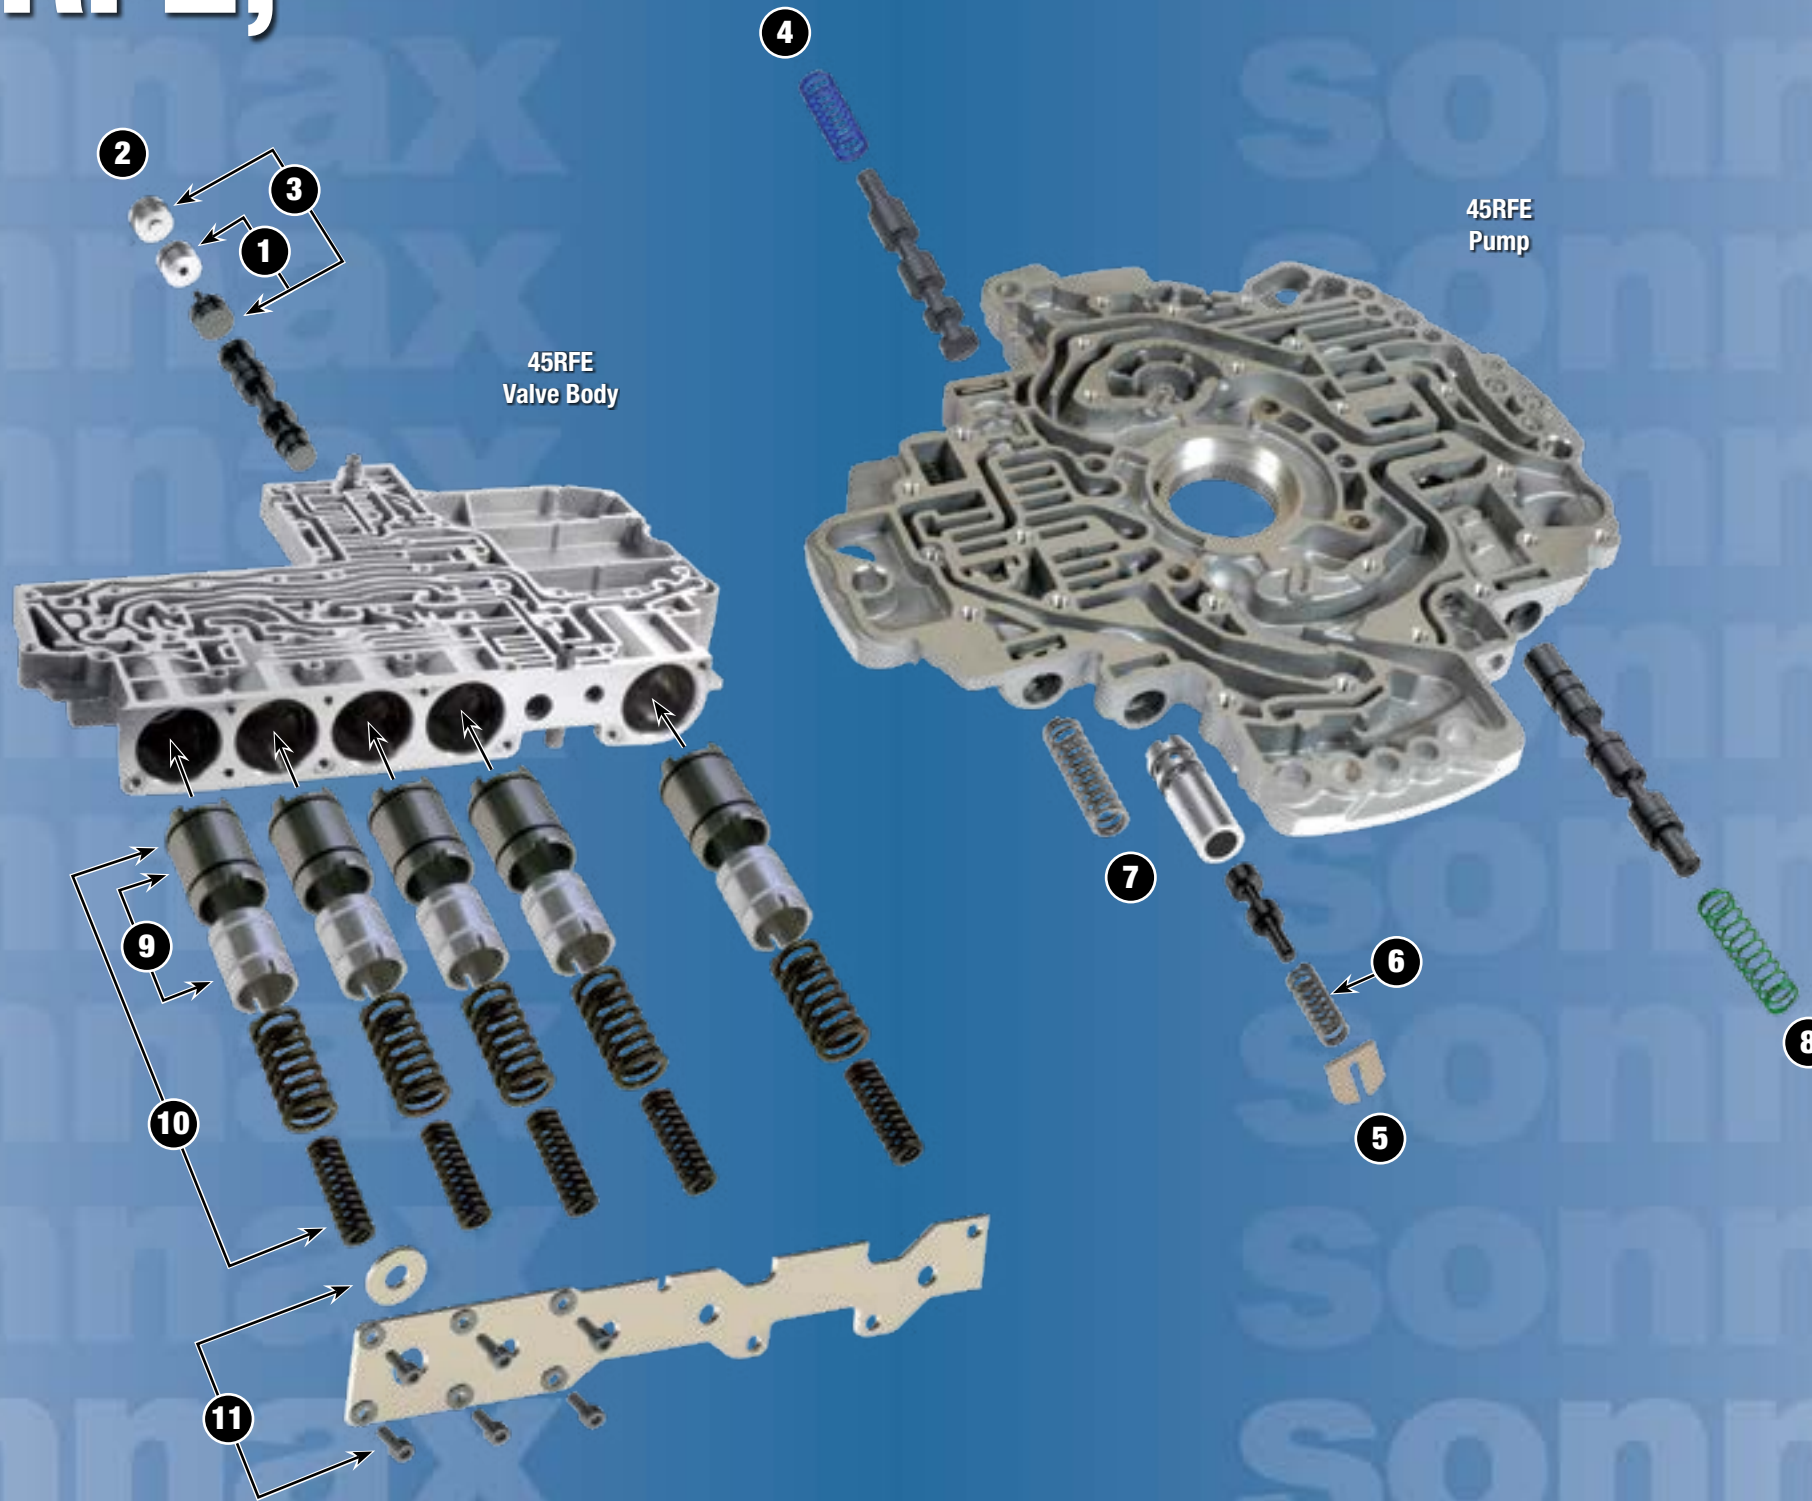

5 44912-03K TC Limit Valve Kit

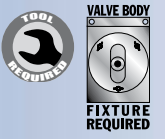

Helps cure:

- Delayed engagement
- Loss of power & fuel economy
- Overheated converter

Note: Requires tool kit F-44912-TL & the
VB-FIX reaming fixture.

6 44912-02 5/Bag TCC Converter Limit Spring

Note: Fits OE aluminum valves found in early-
style units only. Do not use with 44912-03K.

Helps cure:


- Broken spring
- Delayed engagement
- Engine stall on engagement

7 44912-01 5/Bag TCC Accumulator Spring

Helps cure:

- Harsh TCC engagement
- TCC apply & release concerns

8 44912-10K Oversized Pressure Regulator Valve Kit

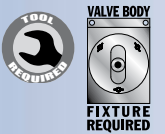

Helps cure:

- Erratic or high line pressure
- Restricted cooler & lube flow
- Soft shifts • Burnt clutches

Note: Requires tool kit F-44912-TL10 & the
VB-FIX reaming fixture.

9 92834-03K Firmer Shift than OE

10 92834-05K OE Shift Quality Accumulator Piston & Sleeve Kit

Fits Any of 5 Locations in
45RFE & 545RFE Only

Helps cure:

- 1-2 Shudder
- Coastdown clunk
- High CVIs
- Slide shifts

11 44892-01K Accumulator Cover Plate Kit



Helps cure:

- Damaged accumulator plate

Note: Requires tool kit 44892-TL.