

# Ford 6F50, 6F55

# sonnax®

TIME TESTED • INDUSTRY TRUSTED®

1 Automatic Drive • P.O. Box 440 • Bellows Falls, VT 05101-0440 USA  
(800) 843-2600 • (802) 463-9722 • F: (802) 463-4059 • www.sonnax.com



Zip Kit®  
6F50-ZIP

This Sonnax kit is also available, see [www.sonnax.com](http://www.sonnax.com) for details.

## 1 124740-24K Oversized TCC Regulator Valve Kit




Helps cure:

- Harsh/No TCC apply
- Codes 741, 742

Note: Requires tool kit F-124740-TL24 & the VB-FIX reaming fixture.

## 2 124740-14K Oversized TCC Control Valve Kit

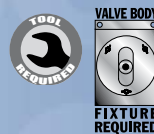

Helps cure:

- TCC apply/release concerns
- Low cooler flow

Note: Requires tool kit F-124740-TL14 & the VB-FIX reaming fixture.

## 3 124740-16 Isolator Valve Spring

5/Bag

Helps cure:


- No/Low line pressure
- Line pressure instability

## 4 124740-03K Isolator Valve Kit

Helps cure:

- No/Low line pressure
- Line pressure instability


## 5 124740-12K Oversized Pressure Regulator Valve Kit

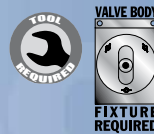

Helps cure:

- Harsh/Soft shifts
- Burnt clutches

Note: Requires tool kit F-144740-TL12 & the VB-FIX reaming fixture.

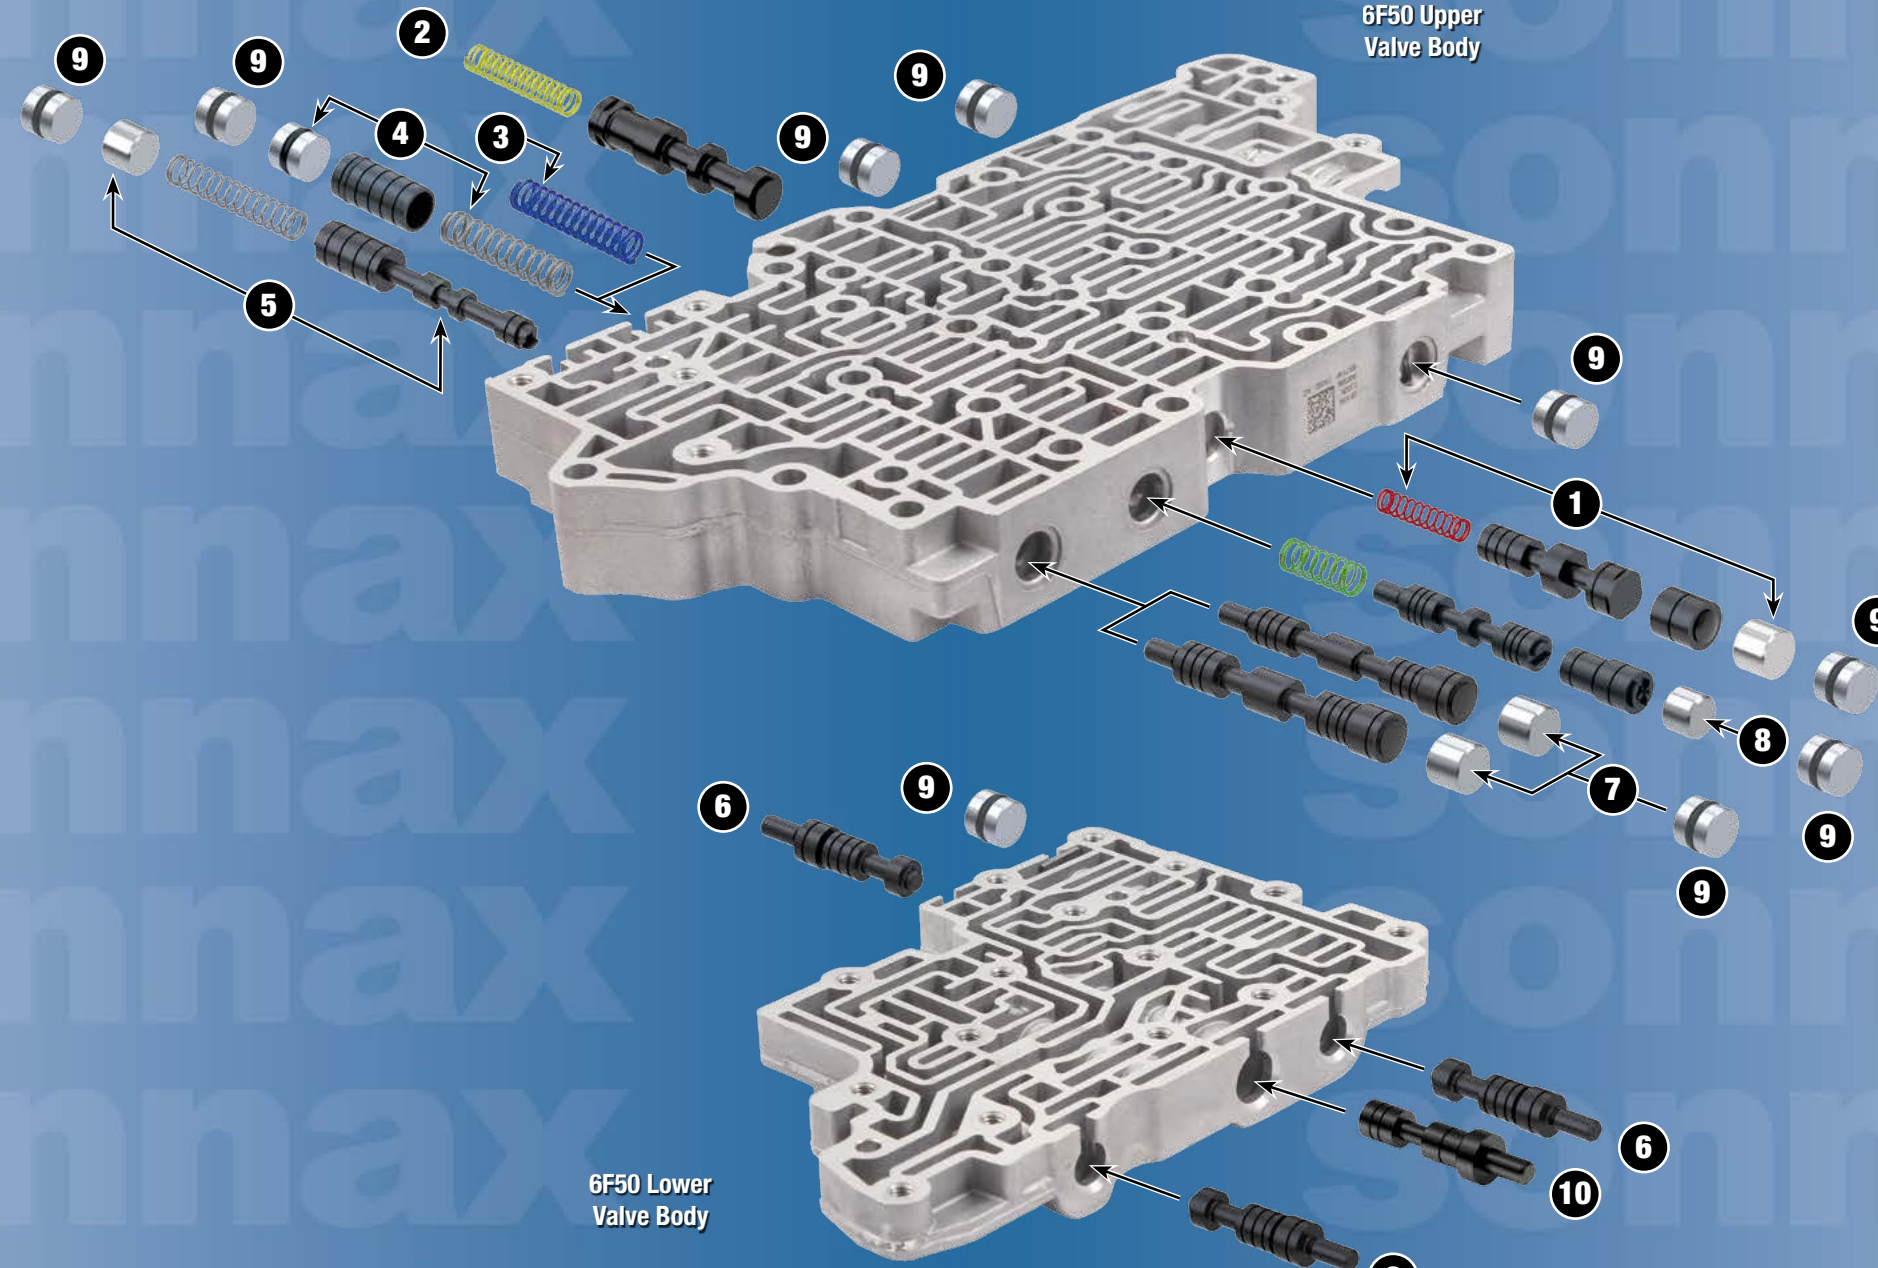

6F50 Upper  
Valve Body

6F50 Lower  
Valve Body

## 6 144740-23 Oversized Clutch Latch Valve



Fits any of 3 locations

Helps cure:

- Slips/Flares/Burnt clutches
- Delayed engagement

Note: Requires tool kit F-144740-TL22 & the VB-FIX reaming fixture.

## 7 124740-21K 124740-26K Oversized 3-5-R Clutch Regulator Valve Kits



1.83 Ratio

1.35 Ratio

Helps cure:

- 3rd & 5th Gear shift concerns
- Burnt 3-5-R clutch

Note: 124740-21K requires tool kit F-124740-TL21, 124740-26K requires tool kit F-124740-TL26 & they both require the VB-FIX reaming fixture.

## 8 124740-17K Oversized 2-6 Clutch Regulator Valve Kit



Helps cure:

- 2nd & 6th Gear shift concerns
- Burnt 2-6 clutch

Note: Requires tool kit F-124740-TL17 & the VB-FIX reaming fixture.


## 9 124740-02K O-Ringed End Plug Kit

Fits 9 locations

Helps cure:

- Shift concerns
- Burnt clutches

## 10 124740-01 Oversized AFL/Solenoid Regulator Valve

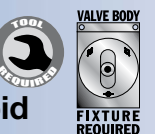

Helps cure:

- Solenoid codes
- Wrong gear starts

Note: Requires tool kit F-104740-TL12 & the VB-FIX reaming fixture.