

Hyundai/Kia

A6GF1,

A6LF1/2/3, A6MF1/2

sonnax®

TIME TESTED • INDUSTRY TRUSTED®

1 Automatic Drive • P.O. Box 440 • Bellows Falls, VT 05101-0440 USA  
(800) 843-2600 • (802) 463-9722 • F: (802) 463-4059 • www.sonnax.com

① 102741-01K

TCC Pressure Control  
Plunger Valve Kit

Helps cure:

- Converter shudder & failure
- TCC codes
- TCC slip

② 102741-11K

Oversized TCC  
Control Valve Kit

Helps cure:

- TCC apply/release concerns
- Excess TCC slip
- TCC codes

Note: Requires tool kit F-102741-TL11  
& the VB-FIX reaming fixture.

③ 102741-08K

Oversized Pressure  
Regulator Valve Kit

Helps cure:

- Burnt clutches
- Erratic line pressure
- Poor shift quality

Note: Requires tool kit F-102741-TL8  
& the VB-FIX reaming fixture.

④ 102741-07 Fits either of 2 locations

Oversized Pressure  
Reducing Valve

Helps cure:

- Burnt clutches
- Harsh/soft shifts
- Solenoid codes


Note: Requires tool kit F-102741-TL7  
& the VB-FIX reaming fixture.



A6MF2 Inner  
Valve Body



A6MF2 Middle  
Valve Body

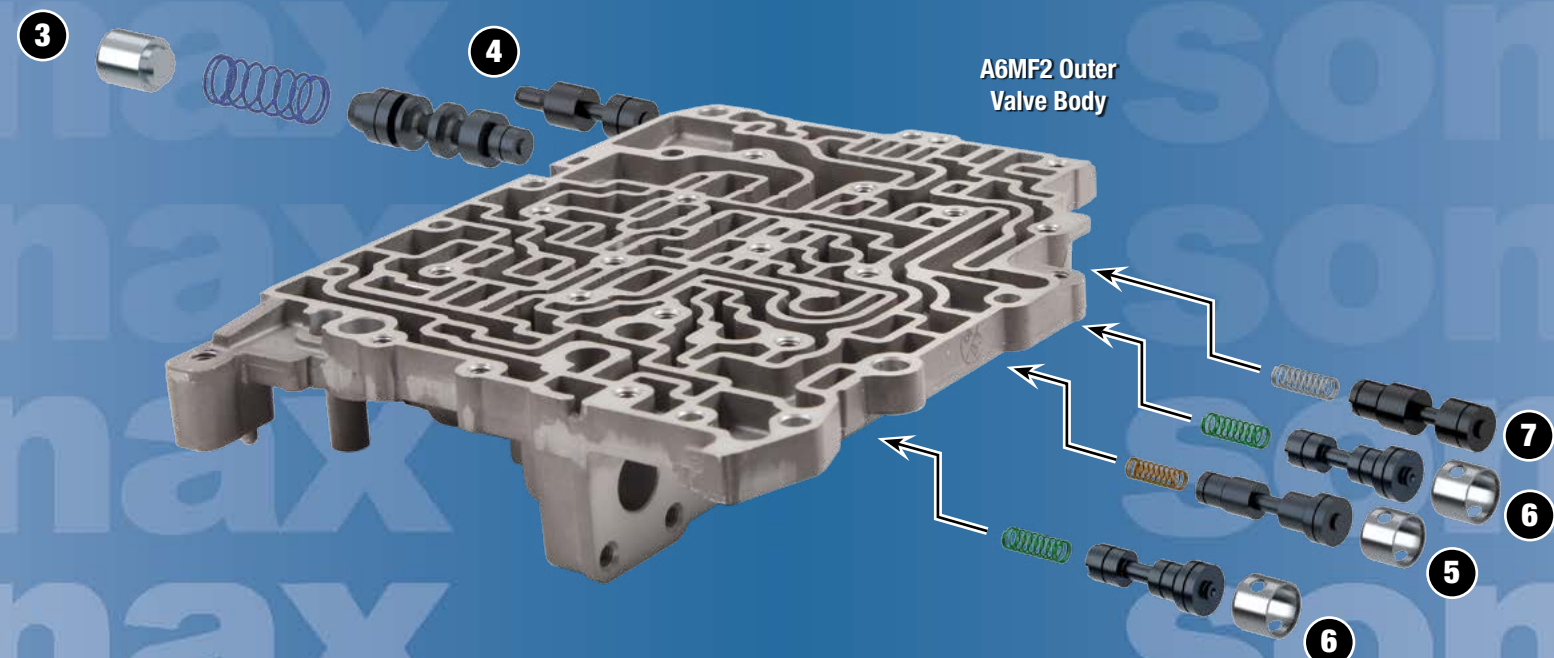

A6MF2 Outer  
Valve Body

⑤ 102741-16K

Oversized 2-6 Pressure  
Control Valve Kit

Helps cure:

- 1-2, 5-6 Flare
- 2-6 Clutch burned
- No/Slipping 2nd, 6th gear

Note: Requires tool kit F-102741-TL16  
& the VB-FIX reaming fixture.



⑥ 102741-13K Fits either of 2 locations

Oversized 3/5/Reverse  
& Underdrive Pressure  
Control Valve Kit

Helps cure:

- Slips, flares, bind-ups
- Underdrive brake clutch burned
- Erratic shift timing

Note: Requires tool kit F-102741-TL13  
& the VB-FIX reaming fixture.



⑦ 102741-18K

Oversized Overdrive  
Pressure Control Valve Kit

Helps cure:

- 3-4 Flare
- 4-5-6 Slip

Note: Requires tool kit F-102741-TL18  
& the VB-FIX reaming fixture.

