


1 33741B-04K*
Oversized Volumetric
Flow Rate Kit

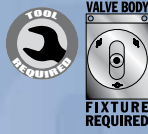


Helps cure:

- Chatter on acceleration
- Chain & sheave (pulley) surface damage

Note: Requires tool kit F-33741B-TL4 & the VB-FIX reaming fixture.

2 33741B-08K*
Oversized UV
Reduction Valve Kit

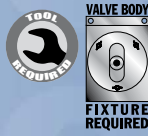

Helps cure:

- Chatter on acceleration
- Ratio errors


Note: Requires tool kit F-33741B-TL8 & the VB-FIX reaming fixture.

3 33741B-10*
UV Adjustable End Plug

Helps cure:

- Chatter on acceleration
- Sluggish acceleration

4 33741B-01*
Oversized Safety Valve

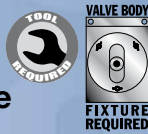

Helps cure:

- Delay/Harsh forward engagement
- Chatter on forward engagement

Note: Requires tool kit F-33741B-TL1 & the VB-FIX reaming fixture.



Valve Plate

5 33741B-07
Oversized VSTV Pilot
Pressure Valve




Helps cure:

- Unstable solenoid pressure
- Delayed engagement
- Chatter on acceleration

Note: Both valves require tool kit F-33741B-TL6 & the VB-FIX reaming fixture.

6 33741B-02K
Oversized Clutch
Control (KSV)
Valve Kit

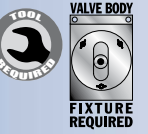

Helps cure:


- Clutch chatter on Forward or Reverse engagement
- Clutch friction failure & overheat

Note: Both kits require tool kit F-33741B-TL2 & the VB-FIX reaming fixture.



Pump Plate

7 33741B-11K
Oversized VSPV
Valve Kit

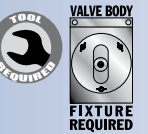

Helps cure:

- Increased push belt & pulley wear
- Push belt slippage
- Ratio codes
- Slipping

Note: Requires tool kit F-33741B-TL11 & the VB-FIX reaming fixture.