

Chrysler 845RE; ZF8HP45, ZF8HP70

sonnax®

TIME TESTED • INDUSTRY TRUSTED®

1 Automatic Drive • P.O. Box 440 • Bellows Falls, VT 05101-0440 USA
(800) 843-2600 • (802) 463-9722 • F: (802) 463-4059 • www.sonnax.com



This Sonnax kit also is available, see www.sonnax.com for details.

Zip Kit®
ZF8-ZIP

1 35740-13K Oversized TCC Valve Kit




Helps cure:

- Converter shudder & TCC slip
- TCC codes
- Overheated converter

Note: Requires tool kit F-35740-TL13 & the VB-FIX reaming fixture.

2 35740-18K Oversized TC Pressure Valve Kit

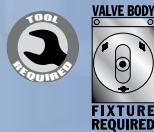


Helps cure:

- TCC codes & overheating
- Harsh TCC apply
- Excess TCC slip
- Coastdown clunk

Note: Requires tool kit F-35740-TL5 & the VB-FIX reaming fixture.

3 35740-05 Oversized TC Switch Valve

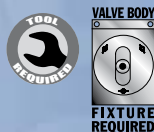

Helps cure:

- No lockup
- Soft & harsh TCC apply
- Excess TCC slip
- TCC codes


Note: Requires tool kit F-35740-TL5 & the VB-FIX reaming fixture.

4 35740-03 Pressure Regulator Sleeve

Helps cure:

- Harsh/Erratic line pressure
- Restricted converter/lube flow

5 35740-01K Oversized Pressure Regulator Valve Kit

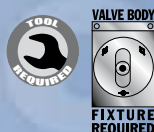

Helps cure:

- Harsh/Soft shifts
- High line pressure
- Burnt clutches
- Restricted converter/lube flow

Note: Requires tool kit F-35740-TL & the VB-FIX reaming fixture.

ZF8HP45
Upper
Valve Body




ZF8HP45
Lower
Valve Body



NOTE: All parts listed also fit the ZF8HP55, but bore location may be different. Please see individual part pages for details on www.sonnax.com.

6 35740-21K Oversized Priming Valve Kit

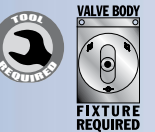


Helps cure:

- Harsh/Flare/Neutral shifts
- Gear ratio & solenoid codes
- Wrong gear starts
- Delayed engagement

Note: Requires tool kit F-35740-TL20 & the VB-FIX reaming fixture.

7 35740-20K Oversized Clutch Holding Valve Kit

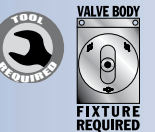

Fits 5 Locations

Helps cure:

- Bump/Flare shifts
- Burnt clutch
- Gear ratio & solenoid codes
- Gear loss

Note: Requires tool kit F-35740-TL20 & the VB-FIX reaming fixture.


8 95740-15K Accumulator Piston Kit

Contains 7 Sets

Helps cure:

- EDS codes
- Firm shifts
- Harsh engagement

9 35740-22 Oversized B2 Clutch NIC Valve

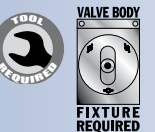

Helps cure:

- B Clutch burned
- Delayed/No Forward & Reverse
- NIC concerns

Note: Requires tool kit F-35740-TL22 & the VB-FIX reaming fixture.

10 35740-30K O-Ringed End Plug Kit

3 End Plugs
8 Internal End Plugs

Helps cure:

- Burnt clutches
- Harsh/Soft/Flare shifts
- Pressure loss