

COMPLAINT

SECONDARY COMPLAINT

No TCC apply, soft or slipping apply, converter slip codes

- Soft and harsh TCC applies

CAUSE

TCC regulated apply valve bore wear can cause the apply valve to stick in the apply or release positions, resulting in the TCC not applying or soft or harsh TCC applies.

CORRECTION


Install this TCC regulated apply valve sleeve kit by oversizing the OEM bore with the drill and reamer kit.

TCC Regulated Apply Valve Sleeve

33000-02
TCC Regulator Apply Sleeve



33000-TL
1 Core Drill
1 Drill Guide
1 Reamer
1 Reamer Guide

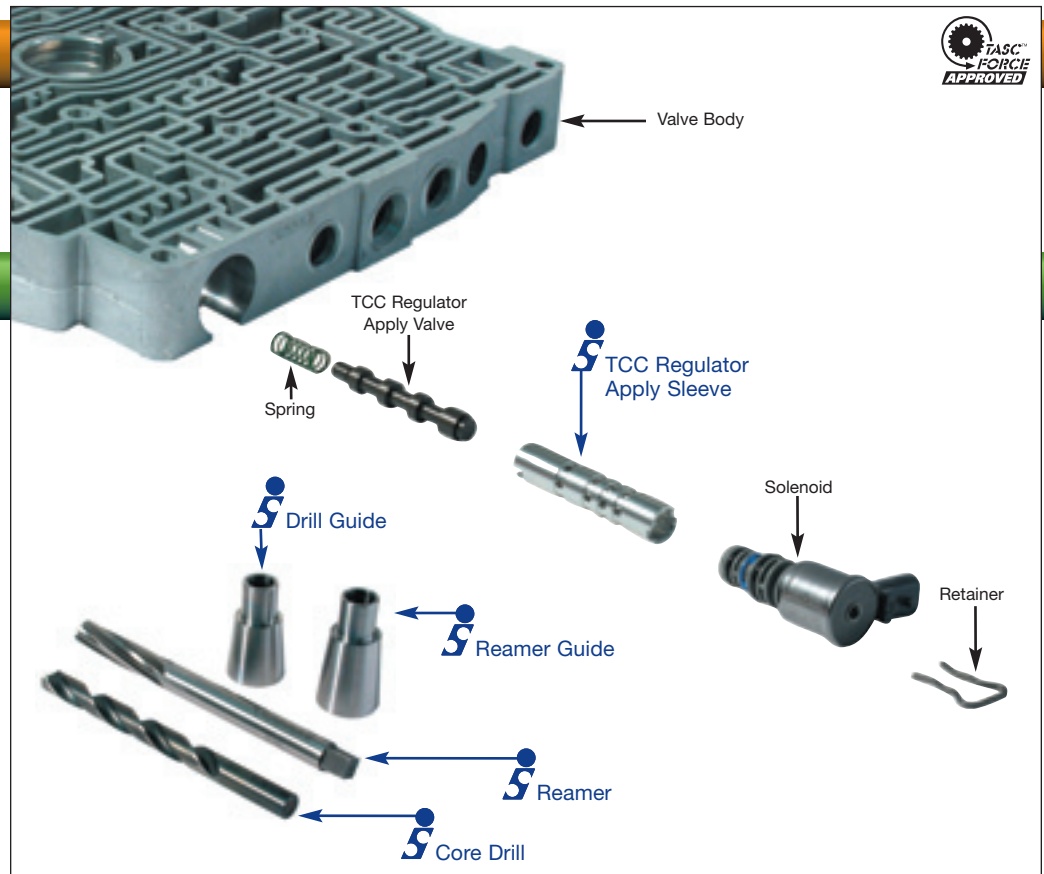

Sonnax Part Summary

In vehicles with 4T40-E transmissions it is common to have either soft or slipping TCC apply or no TCC apply at all. These symptoms are commonly caused by the TCC regulated apply valve wearing out the bore and allowing the valve to stick. Sonnax has developed a replacement TCC regulated apply sleeve **33000-02** to address these complaints.

Features & Benefits

- Sleeve is installed using the original OEM valve, allowing the bore to be restored, and eliminating sticking.
- Sleeve is made from high-quality aluminum to resist wear and increase longevity.

Save

\$150 to \$200 in valve body replacement costs

