

COMPLAINT

SECONDARY COMPLAINTS

TCC apply/release problems

- Converter codes
- Burned converters

CAUSE

Continuous oscillation of the steel lockup control plunger valve wears the cast-aluminum sleeve bore, allowing converter apply pressure to exhaust and preventing proper control of the lockup control valve.

CORRECTION


The tightly tolerated, drop-in replacement Sonnax valve and sleeve assembly restores proper hydraulic clearances and uses upgraded materials to prevent wear.

Lockup Control Plunger Valve & Sleeve Kit

57917E-03K

- 1 Lockup Control Plunger Valve
- 1 Lockup Control Sleeve

Note: Fits applications U140E/F, U151E/F, U240/241E & U250E.

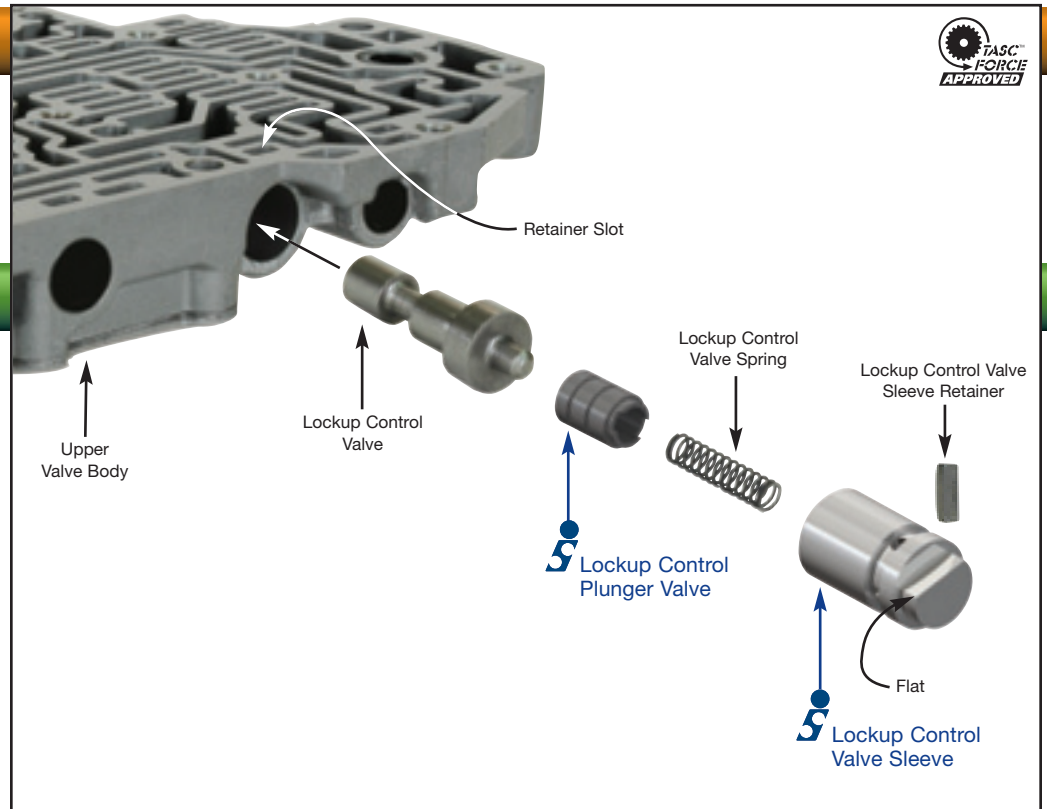

Features & Benefits

- The Sonnax sleeve is manufactured from highly wear-resistant billet aluminum.
- The Sonnax valve has been manufactured from hard-coat anodized aluminum to prevent wear.
- Annular grooves have been added to the valve to prevent sideloading-related wear.

You need this if...

Visual inspection indicates wear to the original assembly.