

COMPLAINT

SECONDARY COMPLAINTS

Worn or scored accumulator bores

- Damaged cases

CAUSE

Repeated oscillation of the accumulator piston scores the 3-4 accumulator bore during normal operation.

CORRECTION

This simple drop-in solution comes with an aluminum sleeve, a replacement piston with an o-ring seal, and a new accumulator pin. It is compatible with all OEM accumulator springs.

3-4 Accumulator Sleeve Kit

77998-01K

- 1 Repair Sleeve
- 1 Piston with O-Ring
- 1 Accumulator Pin


Also Available:

K77898 77898E-K

Reverse Boost Valve Kits

77999

Accumulator Pin Kit

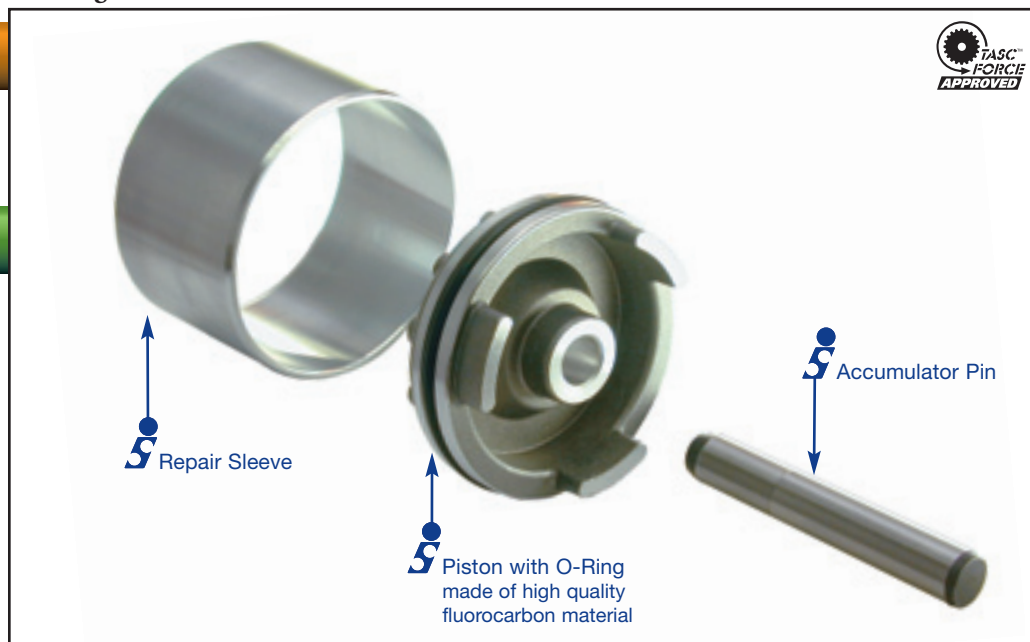

Sonnax Part Summary

The 3-4 accumulator bore on the 4L60 & E cases can become scored, resulting in the loss of 4th servo feed and 4th accumulator pressure. Scoring is caused by repeated oscillation of the accumulator piston within the bore during normal operation. Once this bore is damaged the case must be scrapped. Install the Sonnax Accumulator Sleeve Kit 77998-01K.

Features and Benefits

- Sleeve is manufactured from wear-resistant aluminum.
- Piston with o-ring seal is made of high-quality fluorocarbon material.
- Kit includes new accumulator pin.
- Piston is compatible with all OEM accumulator springs.
- Requires no machining of the transmission case.