

Toyota/Lexus

A760E/F/H, A761E, A960E/F, AB60E/F

sonnax®

TIME TESTED • INDUSTRY TRUSTED®

1 Automatic Drive • P.O. Box 440 • Bellows Falls, VT 05101-0440 USA
(800) 843-2600 • (802) 463-9722 • F: (802) 463-4059 • www.sonnax.com

A761E Valve Body

Upper Valve
Body No. 2

Upper Valve
Body No. 1

Lower
Valve Body
No. 1

Lower Valve
Body No. 2



Installed in
Several Locations


1 147741-07K

Oversized Lockup Relay Valve Kit

Helps cure:

- TCC apply/release concerns & codes
- Burnt converter

Note: Requires tool kit F-147741-TL7 & the VB-FIX reaming fixture.

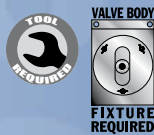

2 147741-10K

Oversized Secondary Pressure Regulator Valve Kit

Helps cure:

- TCC apply & release concerns
- Burnt converter

Note: Requires tool kit F-147741-TL4 & the VB-FIX reaming fixture.



3 147741-01K

Boost Valve Kit

Helps cure:

- Low line rise in Drive
- Higher-than-normal Reverse pressures



4 147741-04K

Oversized Main Pressure Regulator & Boost Valve Kit

Helps cure:

- Low/High line pressure
- Soft and/or harsh shifts

Note: Requires tool kit F-147741-TL4 & the VB-FIX reaming fixture.



5 147741-30K

O-Ringed End Plug Kit

Helps cure:

- Various concerns depending on location of leaking end plug
- Pressure loss



These Sonnax kits also are available, see www.sonnax.com for details.



Zip Kit®
A750E-A761E-ZIP



Line Pressure Booster Kit
A750-LB1


6 147741-05K

Oversized Solenoid Modulator Valve Kit

Helps cure:

- Solenoid codes
- Shift concerns

Note: Requires tool kit F-147741-TL5 & the VB-FIX reaming fixture.

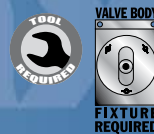


7 147741-14K

Oversized Clutch Control Valve Kit

Helps cure:

- Harsh up/downshifts
- Flare shifts

Note: Requires tool kit F-147741-TL14 & the VB-FIX reaming fixture.

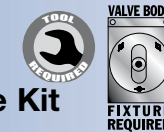

8 147741-37K

Fits A761E, A960E/F Only

Lockup Control Plunger Valve Kit

157740-37K

Fits A760E/F/H, AB60E/F Only

Lockup Control Plunger Valve Kit

9 147741-16K

Oversized Lockup Control Valve Kit

Fits A761E, A960E/F Only

157740-16K

Oversized Lockup Control Valve Kit

Fits A760E/F/H, AB60E/F Only

Helps cure:

- Harsh downshifts
- RPM surge on coast

Note: 147741-16K Requires tool kit F-147741-TL16, 157740-16K requires tool kit F-157740-TL16 & they both require the VB-FIX reaming fixture.



10 147741-43K

Accumulator Control Plunger Valve Kit

11 147741-24K

Oversized Accumulator Control Valve, Plunger Valve Kit

Helps cure:

- Shift concerns & codes
- Harsh shifts

Note: 147741-24K Requires tool kit 147741-TL24.




12 147741-28K

Oversized Brake Control Valve Kit

Helps cure:

- Shift concerns & codes
- Harsh/Flare shifts

Note: Requires tool kit F-147741-TL28 & the VB-FIX reaming fixture.

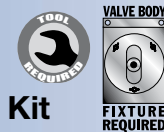

13 147741-13


Fits 2 Locations

Oversized B2 Accumulator Pistons

Helps cure:

- 5-6 Harsh/Slip
- 3-2 Harsh downshifts

Note: Requires tool kit F-147741-TL13 & the VB-FIX reaming fixture.

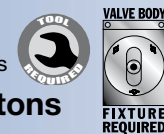

14 57917E-19K

Accumulator Piston Kit

Helps cure:

- Delayed engagement
- Forward flares/slips

