

Ford CFT30

sonnax®

TIME TESTED • INDUSTRY TRUSTED®

1 Automatic Drive • P.O. Box 440 • Bellows Falls, VT 05101-0440 USA
(800) 843-2600 • (802) 463-9722 • F: (802) 463-4059 • www.sonnax.com

1 33740-03K Oversized TCC Regulator Valve Kit



Helps cure:

- Converter shudder & TCC slip
- Loss of fuel economy
- Lube failures
- No lockup
- Overheated fluid & TCC lining
- Poor converter & cooler oil flow
- TCC apply & release concerns
- TCC codes

Note: Requires tool kit F-33740-TL3 & the VB-FIX reaming fixture.

2 33740-06 Oversized TCC Apply Valve



Helps cure:

- Converter shudder & TCC slip
- Loss of fuel economy
- Overheated fluid & TCC lining
- TCC apply concerns
- TCC codes




Note: Requires tool kit F-33740-TL6 & the VB-FIX reaming fixture.

3 33740-01K Primary Pulley Boost Valve Kit

Helps cure:

- No high ratios
- No ratio change
- Poor fuel economy
- Ratio codes
- Ratio errors

CFT30
Channel Plate

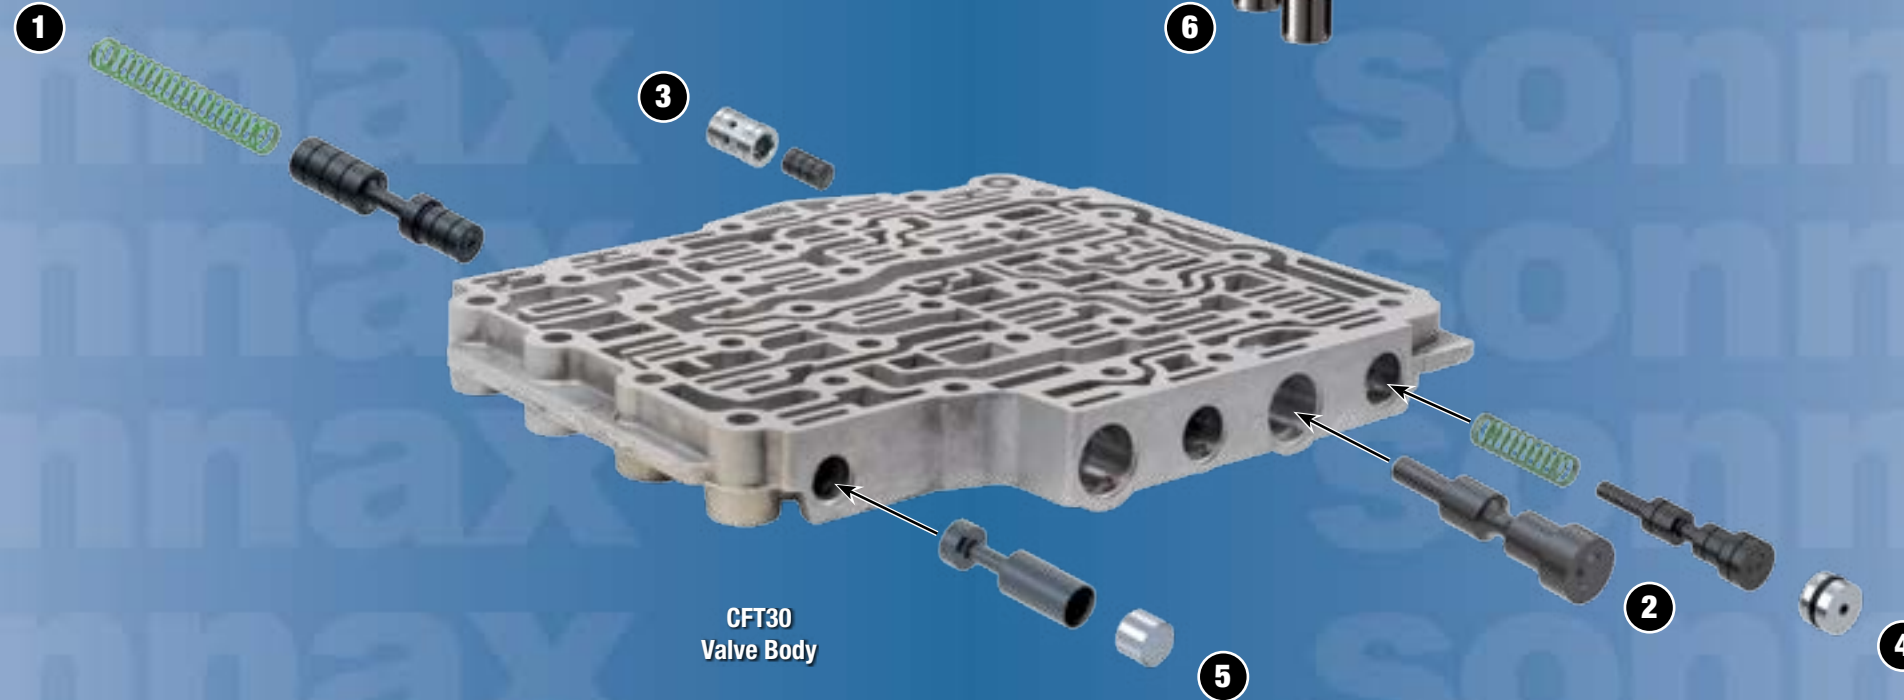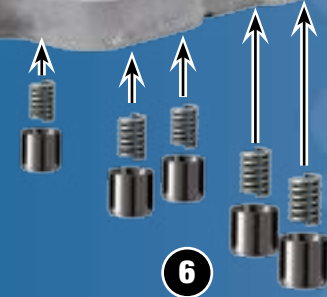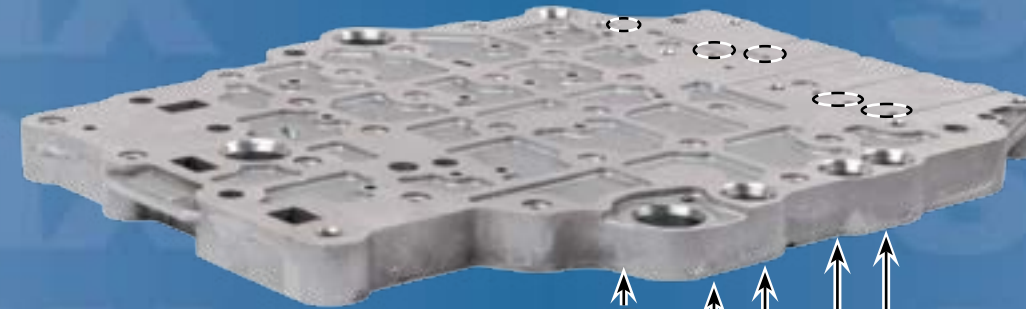

CFT30
Valve Body

4 33740-07K Oversized Forward & Reverse Engagement Latch Valve Kit



Helps cure:

- Code P0811
- Delayed engagement
- Forward/Reverse slip
- Burnt Forward/Reverse clutch
- Overheating

Note: Requires tool kit F-33740-TL7 & the VB-FIX reaming fixture.

5 33740-04K Oversized Lube Regulator Valve Kit



Helps cure:

- Bearing failure
- Overheated fluid
- Planetary failure
- Poor lube oil control

Note: Requires tool kit F-33740-TL4 & the VB-FIX reaming fixture.

6 95740-15K Accumulator Pistons

Fits 5 Locations

Helps cure:

- Harsh downshifts
- Firm shifts
- Erratic EDS solenoid control and/or EDS codes