

Ford 5R55N

sonnax®

TIME TESTED • INDUSTRY TRUSTED®


1 Automatic Drive • P.O. Box 440 • Bellows Falls, VT 05101-0440 USA
(800) 843-2600 • (802) 463-9722 • F: (802) 463-4059 • www.sonnax.com

1 56947J-05K* Oversized TCC Control Valve Kit

Helps cure:

- Excess TCC slip, Code 741
- TCC lining comes off

Note: Requires tool kit F-56947J-TL2, & the VB-FIX reaming fixture.

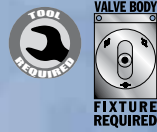


2 56947J-15K* Oversized TCC Modulator Valve & Sleeve Kit

Helps cure:

- Excess TCC slip, Codes 741 & 1783
- Transmission over temperature

Note: Requires tool kit F-56947J-TL15 & the VB-FIX reaming fixture.

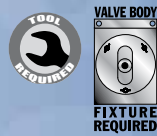

3 56947J-32K TCC Modulator Sleeve & Plunger Valve Kit

Helps cure:



- High TCC slip RPM at increasing load
- Slip codes, Elevated fluid temperature

4 56947J-63K Oversized Converter Clutch Back Pressure Valve Kit

Helps cure:

- Converter burn-up or apply complaints
- Delayed engagements

Note: Requires tool kit F-56947J-TL63 & the VB-FIX reaming fixture.

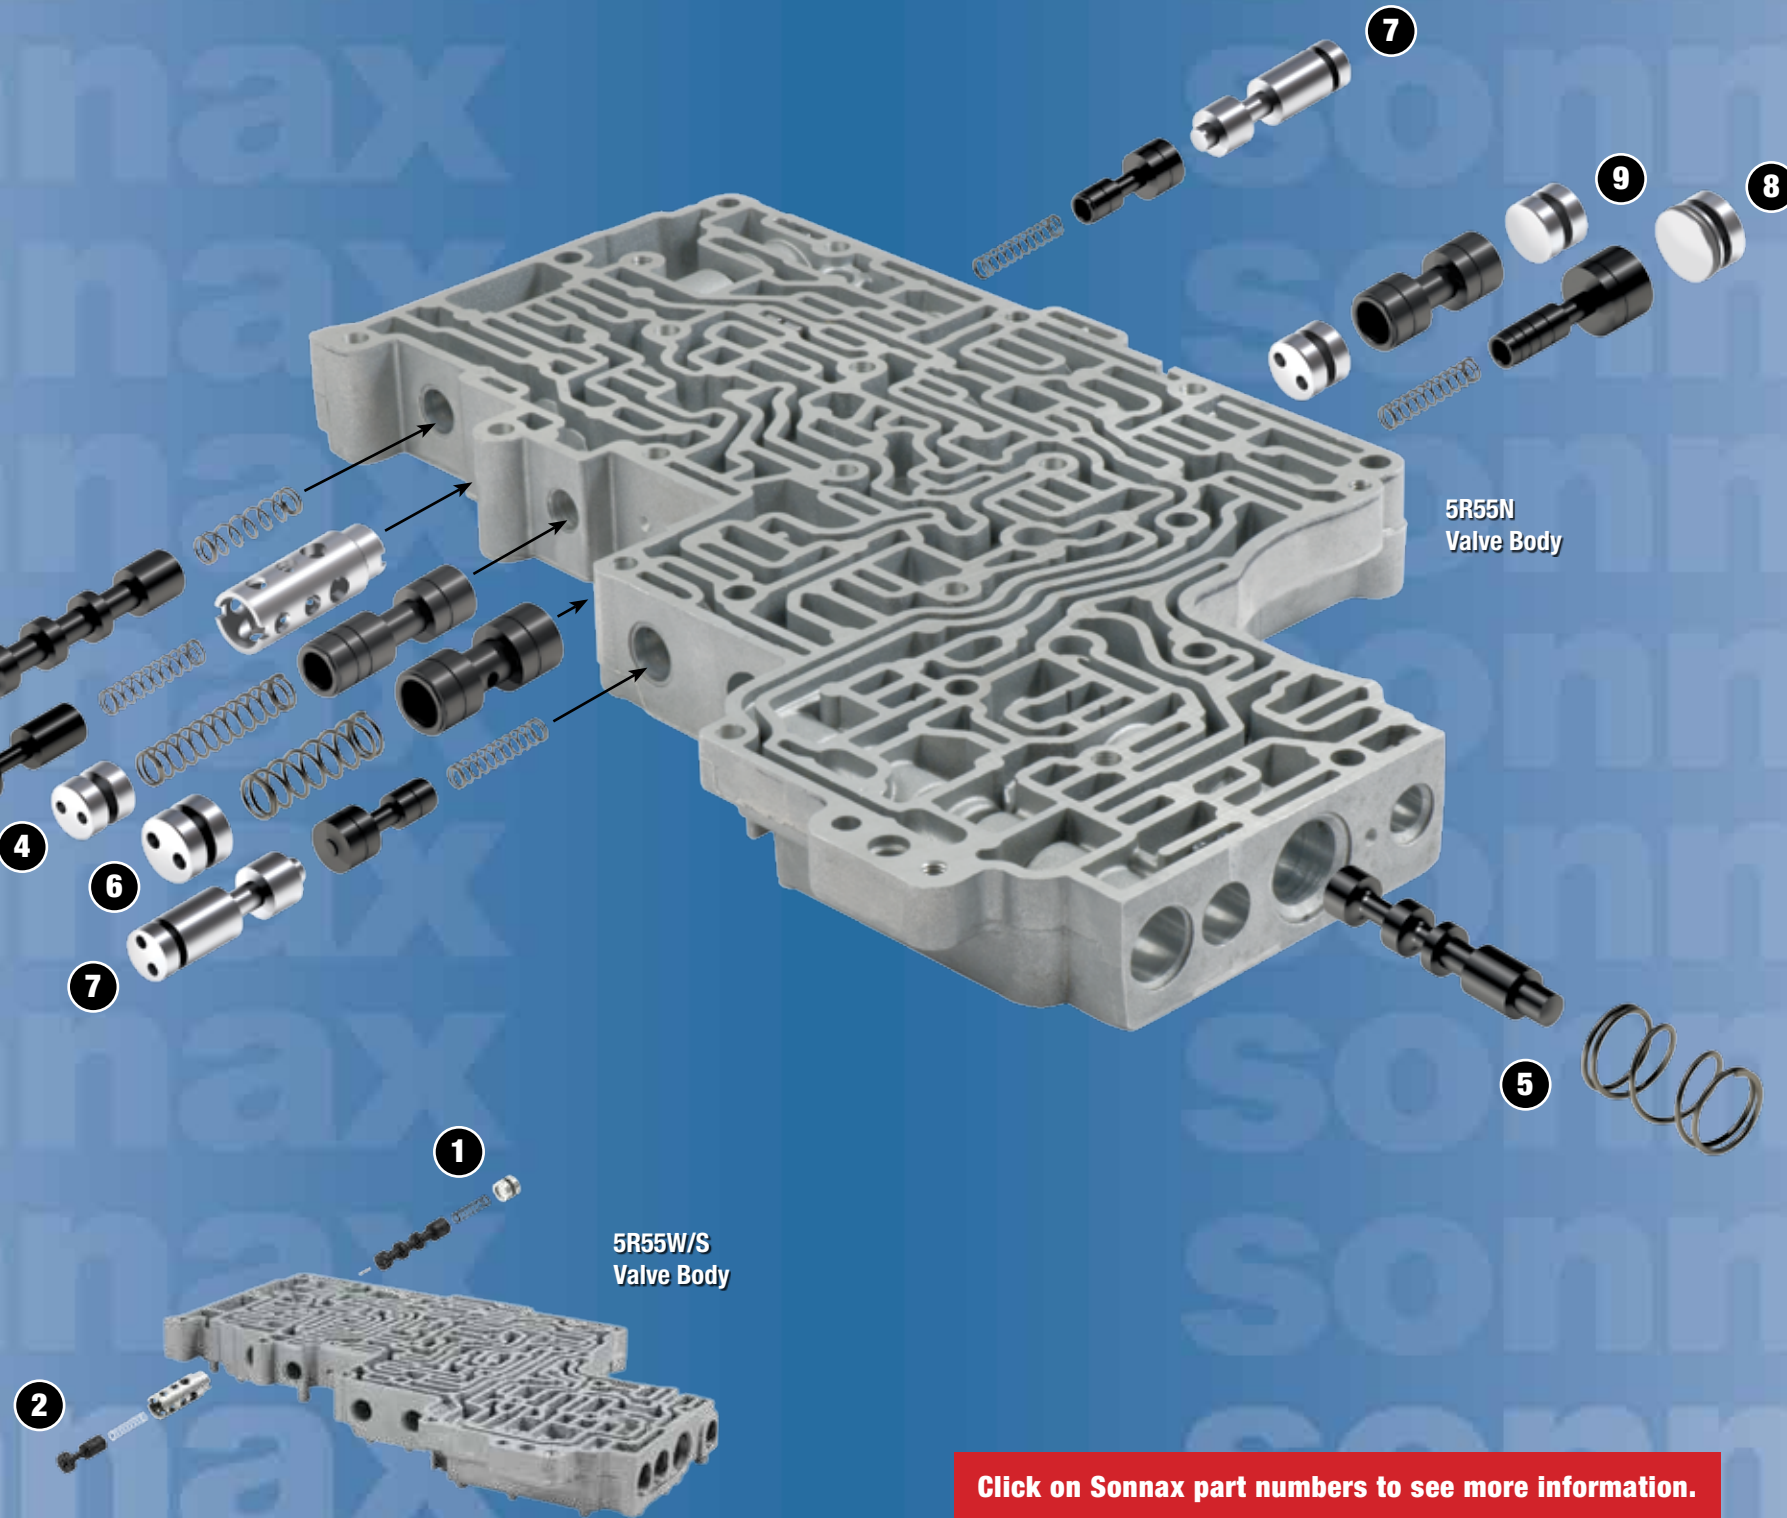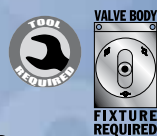


*These parts also fit 5R55W/S units.

5 56947J-39K Oversized Pressure Regulator Valve Kit

Helps cure:

- Delayed engagements, Soft shifts
- High line pressure in reverse

Note: Requires tool kit F-56947J-TL39 & the VB-FIX reaming fixture.

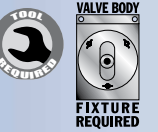


6 56947J-56K Oversized Forward Engagement Valve Kit

Helps cure:

- Slipping or loss of forward gears
- Burned forward clutch

Note: Requires tool kit F-27741-TL13 & the VB-FIX reaming fixture.

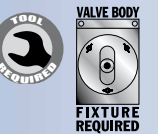


7 56947J-49K Oversized PCA/PCB Modulator Valve Kit

Fits either of 2 locations.

Helps cure:

- Line pressure concerns
- Delayed engagements in forward/reverse

Note: Requires tool kit F-56947J-TL49 & the VB-FIX reaming fixture.

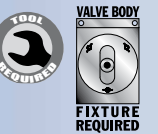


8 56947J-53K Oversized Reverse Modulator Valve Kit

Helps cure:

- Delayed reverse engagement
- Loss of 4th or 5th gear

Note: Requires tool kit F-56947J-TL53 & the VB-FIX reaming fixture.

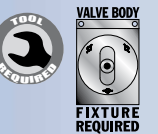


9 56947J-59K Oversized Reverse Engagement Valve Kit

Helps cure:

- Delay or loss of reverse
- Burned direct clutch

Note: Requires tool kit F-27741-TL13 & the VB-FIX reaming fixture.

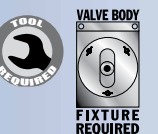

Click on Sonnax part numbers to see more information.