

Ford
AX4N/4F50N

sonnax®

TIME TESTED • INDUSTRY TRUSTED®

1 Automatic Drive • P.O. Box 440 • Bellows Falls, VT 05101-0440 USA
(800) 843-2600 • (802) 463-9722 • F: (802) 463-4059 • www.sonnax.com



This Sonnax kit also is available, see www.sonnax.com for details.

The Sure Cure®
SC-AX4N

- 1 **96206-03K** .486" Dia.
96206-13K .496" Dia.

Bypass Clutch Control Sleeve & Plunger Kits

Helps cure:

- No TCC apply
- Code 741, 1741 or 1744

- 2 **96206-05K**
Oversized Bypass Clutch Control Valve Kit

Helps cure:

- TCC apply & release problems
- Code 741, 1741 or 1744

Note: Requires tool kit **96206-TL**.

- 3 **96201-23K**
Oversized Converter Regulator Valve Kit

Helps cure:

- Delayed engagement, flare upshifts
- Converter slip codes and/or overheat

Note: Requires either tool kit **96201-TL3** or **F-96201-TL23** & the **VB-FIX** reaming fixture.

- 4 **96201-21K**
Oversized Solenoid Regulator Valve Kit

Helps cure:

- No TCC apply
- Code 741, 1741 or 1744

Note: Requires tool kit **96201-TL2**.

- 5 **96206-10K**
Oversized Pressure Regulator Valve Kit

Helps cure:

- Line pressure instability
- Pump noise

Note: Requires tool kit **96206-TL2**.

- 6 O-Ring Style:
96201-01K All except 3.0L 12 Valve
96201-12K 3.0L 12 Valve


Factory Style:

- 96201-08K** All except 3.0L 12 Valve
96201-13K 3.0L 12 Valve

Boost Valve & Sleeve Kits

Helps cure:

- Flare 1-2 or 2-3 upshifts
- Non-adjustable (high) throttle pressure

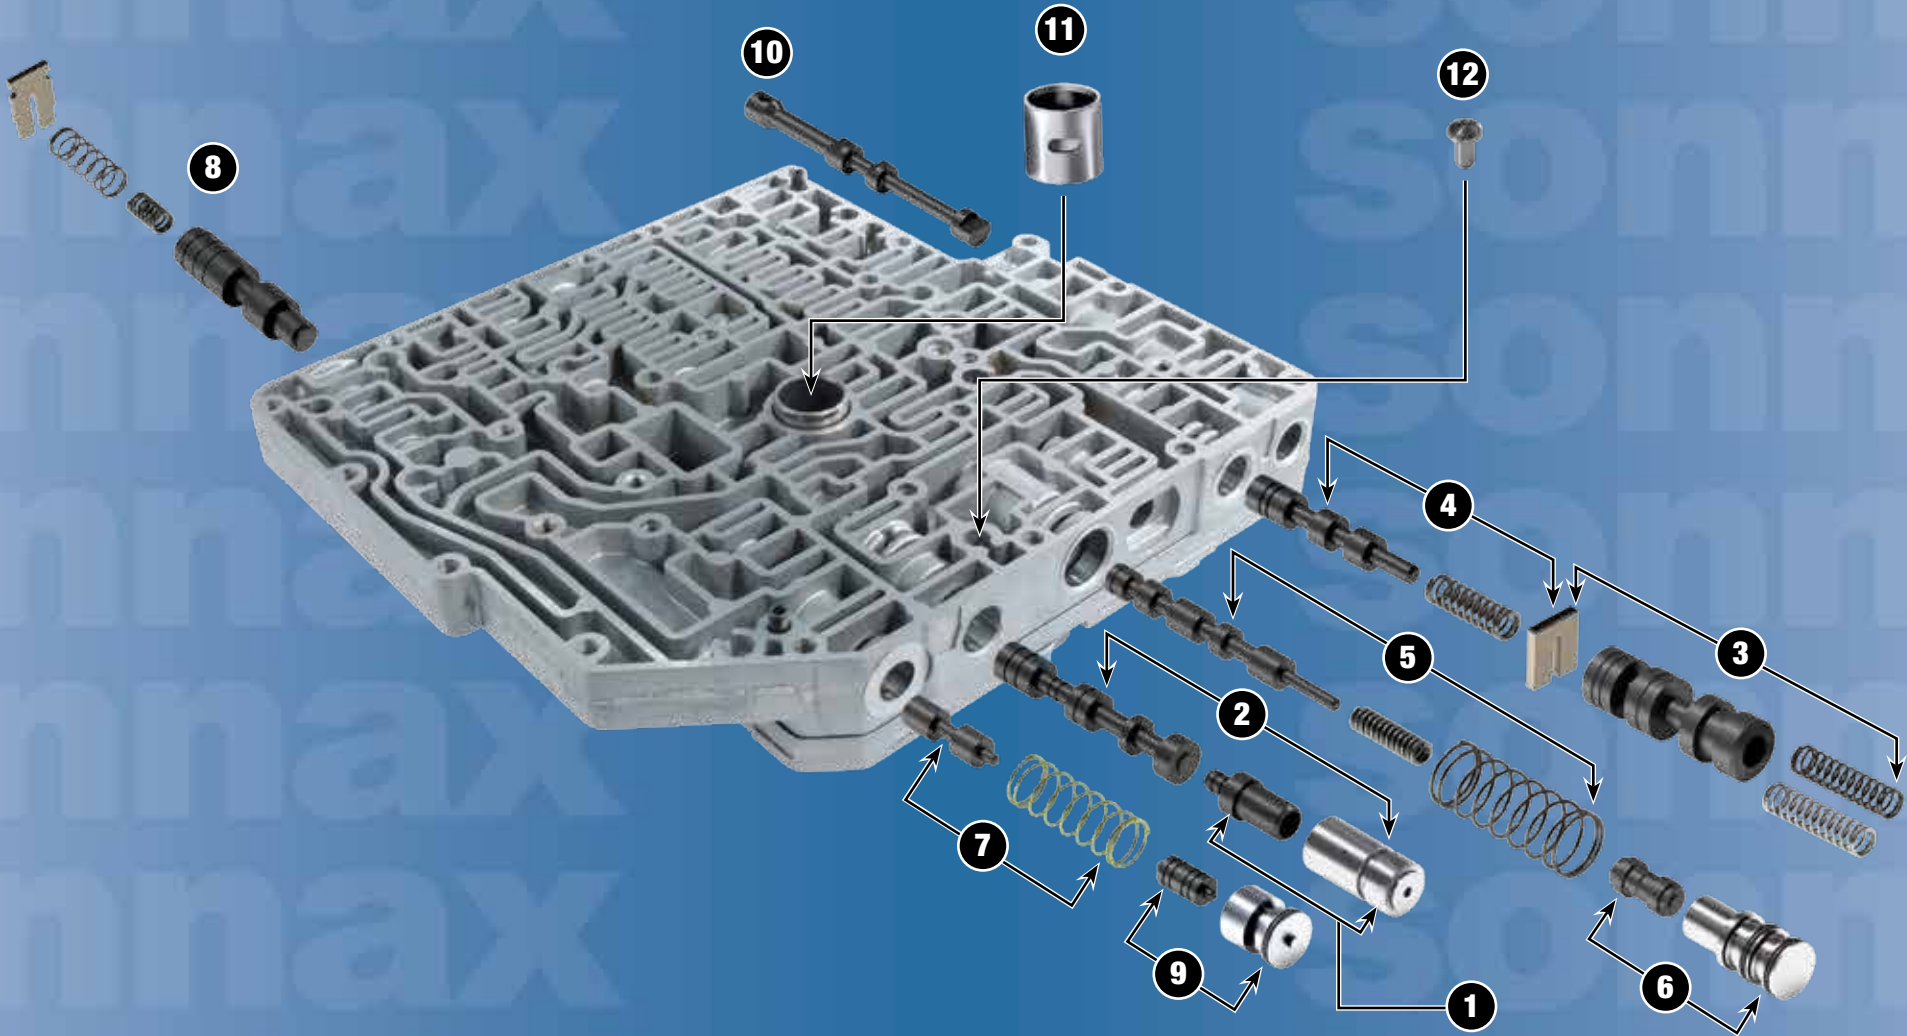

- 7 **36948-20K** '95-'97
Oversized Accumulator Pressure Control Valve Kit

Helps cure:

- Harsh shifts
- Harsh 1-2, soft shifts

Note: Requires tool kit **36948-TL**.

- 8 **96206-07K**
Forward Control Valve Kit

Helps cure:

- No forward
- No 4th gear

Note: Use of bore sizing tool **96206-BST** is not required, but is highly recommended.

- 9 **96948-01K** '97-Earlier
Line Pressure Modulator Valve & Sleeve Kit

Helps cure:

- Soft 1-2 and/or 2-3 shifts
- Intermittent harsh shifts

- 10 **96201-05**
Manual Valve

Helps cure:

- Delayed forward engagement
- Burned forward clutch

- 11 **96201-18**
Pump Shaft Sleeve

Helps cure:

- Oil loss
- Worn sleeve

- 12 **10000-01K**
Low Radius Relief Valve

Helps cure:

- Cooler/converter pressure problems
- Leaking or valve sticking

Click on Sonnax part numbers to see more information.