

# ZF6HP19/26/32 (Gen. 1)

## With 053 Separator Plate

# sonnax®

TIME TESTED • INDUSTRY TRUSTED®

1 Automatic Drive • P.O. Box 440 • Bellows Falls, VT 05101-0440 USA  
 (800) 843-2600 • (802) 463-9722 • F: (802) 463-4059 • www.sonnax.com


This Sonnax kit also is available, see [www.sonnax.com](http://www.sonnax.com) for details.



Zip Kit®  
ZF6-053-ZIP

### 1 95740-05K

#### Oversized Converter Release Regulator Valve Kit

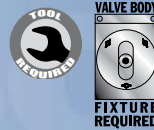


Helps cure:

- Excessive TCC slip, RPM & related codes
- Harsh lockup apply & release

Note: Requires tool kit F-95740-TL5 & the VB-FIX reaming fixture.

### 2 95740-11K

#### Oversized Lubrication Control Valve Kit

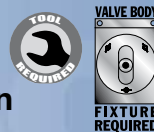

Helps cure:

- Low converter pressure
- Lube failure

Note: Requires tool kit F-95740-TL11 & the VB-FIX reaming fixture.

### 3 95740-13K

#### Oversized Bypass Clutch Control Valve Kit



Helps cure:

- Converter overheat
- Low TCC release pressure

Note: Requires tool kit F-95740-TL13 & the VB-FIX reaming fixture.

### 4 95740-79


#### Pressure Regulator Sleeve

Helps cure:

- Harsh or erratic line pressure
- Broken parts

### 5 95740-78K


#### Oversized Pressure Regulator Valve Kit

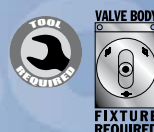

Helps cure:


- Delayed or no reverse
- Poor shift quality

Note: Requires tool kit F-95740-TL78 & the VB-FIX reaming fixture.

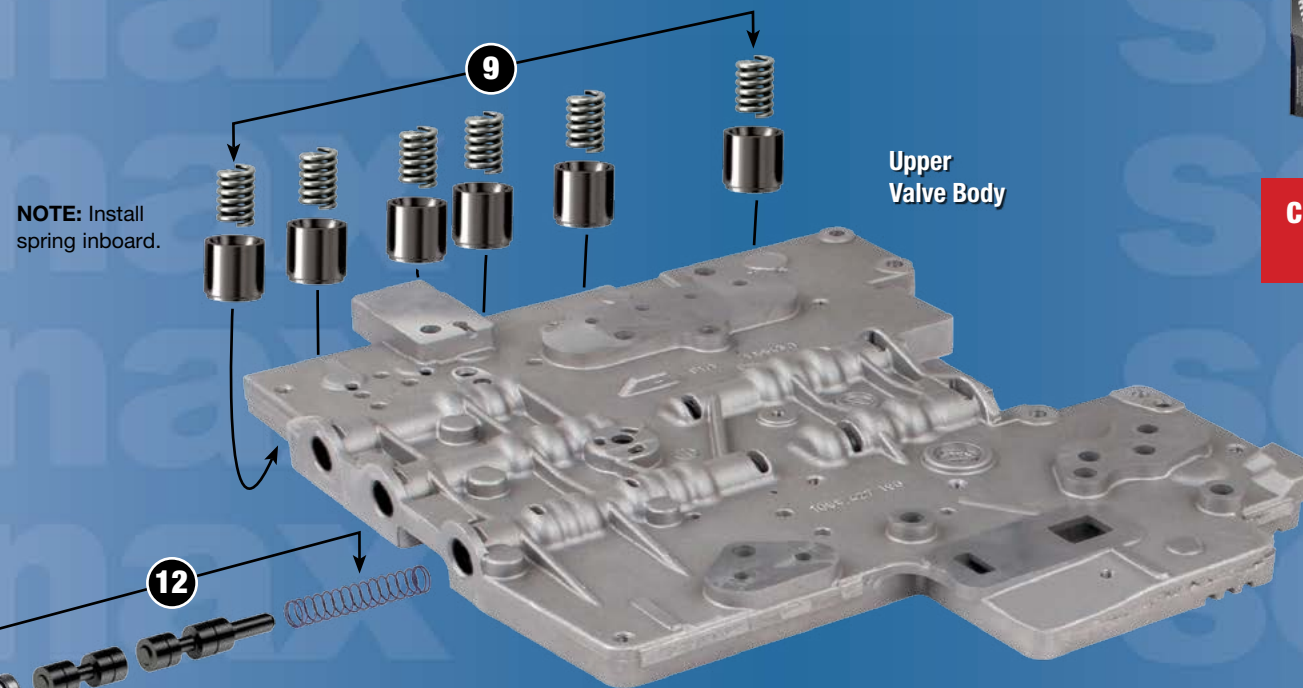

NOTE: Install spring inboard.

Upper Valve Body

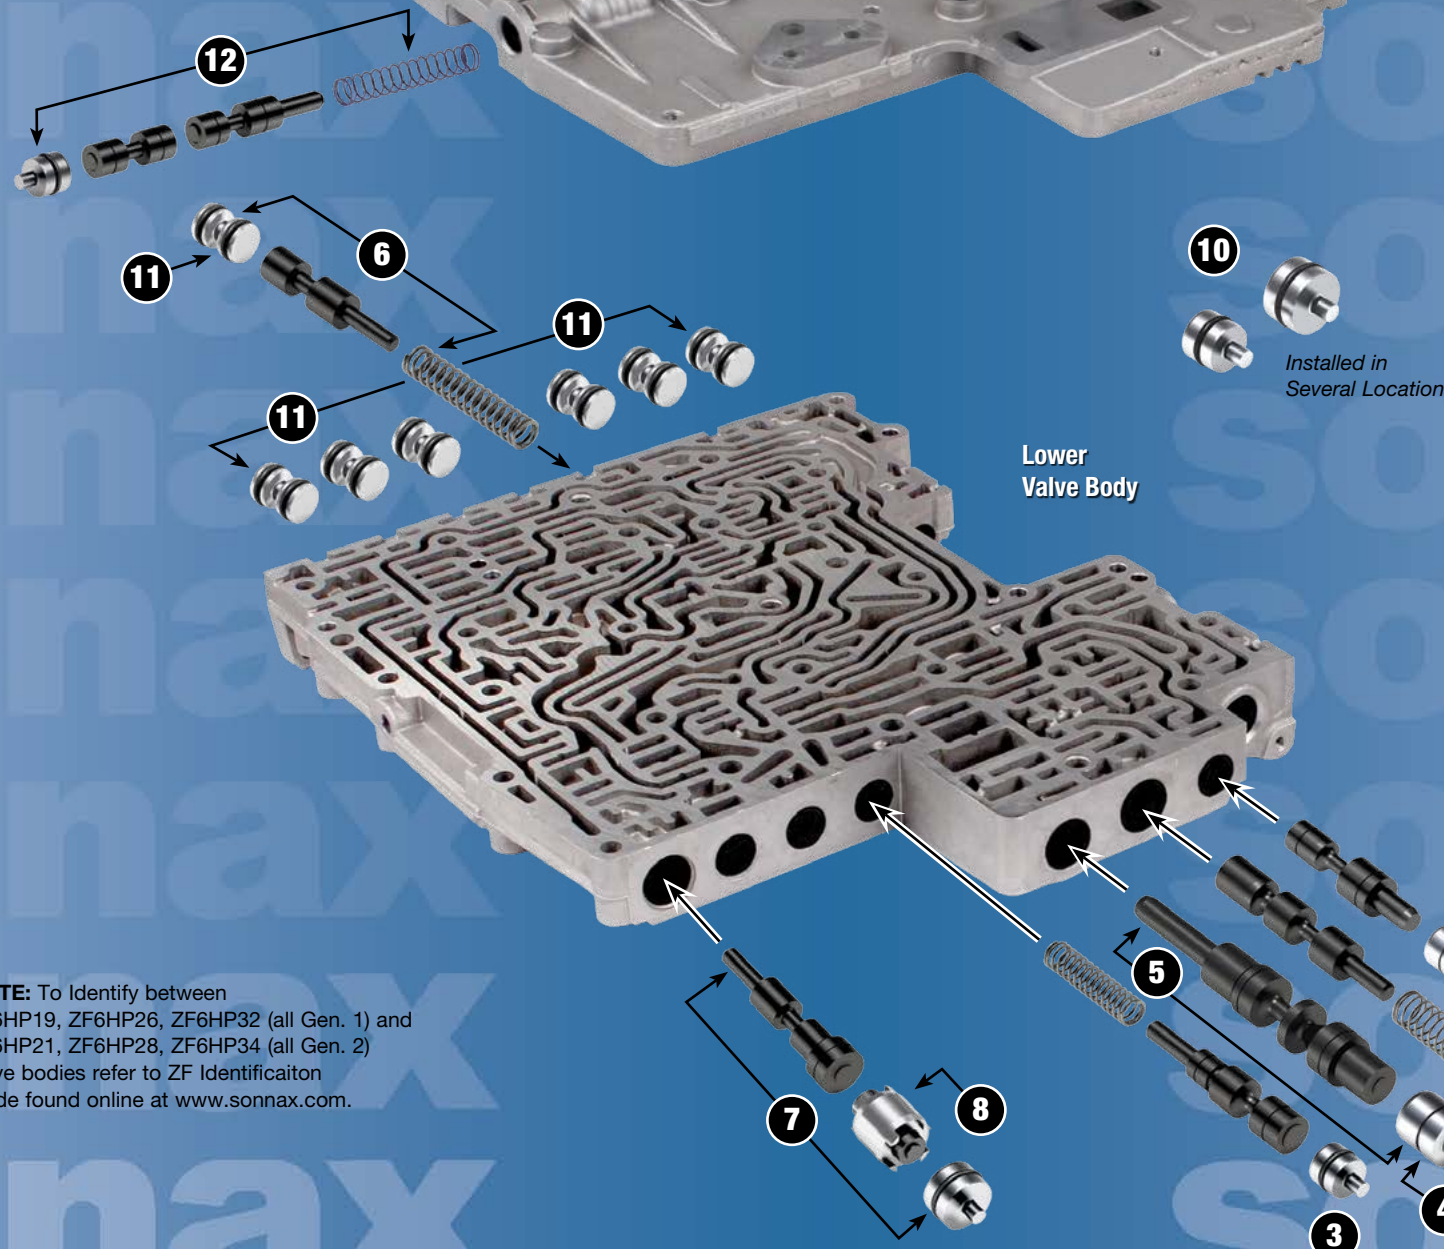

Lower Valve Body


10 Installed in Several Locations

NOTE: To Identify between ZF6HP19, ZF6HP26, ZF6HP32 (all Gen. 1) and ZF6HP21, ZF6HP28, ZF6HP34 (all Gen. 2) valve bodies refer to ZF Identification guide found online at [www.sonnax.com](http://www.sonnax.com).

Click on Sonnax part numbers to see more information.

### 6 95740-17K

#### Oversized Solenoid Pressure Regulator Valve Kit

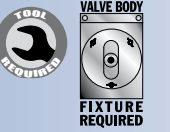


Helps cure:

- Gear ratio or solenoid codes
- Wrong gear starts

Note: Requires tool kit F-95740-TL17 & the VB-FIX reaming fixture.

### 7 95740-09K

#### Oversized Clutch A Control Valve Kit

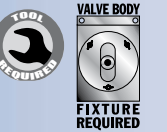

Helps cure:

- Flare upshifts or downshift bind-ups
- Excessive clutch overlap & clutch distress

Note: Requires tool kit F-95740-TL8 & the VB-FIX reaming fixture.

### 8 95740-21K

#### Clutch A Control Boost Valve Kit

Helps cure:

- Delayed/Harsh forward engagement
- Flare/Neutral on 5-4 downshift

### 9 95740-15K

#### Valve Body Accumulator Piston & Spring Kit 7 Sets (1 extra)

Helps cure:

- Firm up/downshift and/or engagement
- Erratic EDS solenoid control

### 10 95740-81K 1 Large & 10 Small Plugs

### 11 95740-30K 7 Plugs (Internal)

#### O-Ringed End Plug Kits

Helps cure:

- Soft/Inconsistent shift feel

### 12 95740-75K

#### Oversized Position Valve Kit



Helps cure:

- Forward engagement complaints
- Reverse engagement complaints
- Solenoid performance trouble codes

Note: 95740-75K requires tool kit F-95740-TL75 & they both require the VB-FIX reaming fixture.