

GM

6T70 (Gen. 1), 6T75 (Gen. 1)

sonnax®

TIME TESTED • INDUSTRY TRUSTED®

1 Automatic Drive • P.O. Box 440 • Bellows Falls, VT 05101-0440 USA
(800) 843-2600 • (802) 463-9722 • F: (802) 463-4059 • www.sonnax.com




Zip Kit®
6T70-ZIP

This Sonnax kit is also available,
see www.sonnax.com for details.

Click on Sonnax part numbers to see more information.

1 124740-24K Oversized TCC Regulator Valve Kit

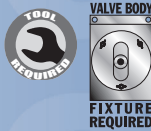


Helps cure:

- Harsh/No TCC apply
- Codes 741, 742

Note: Requires tool kit F-124740-TL24
& the VB-FIX reaming fixture.

2 124740-14K Oversized TCC Control Valve Kit

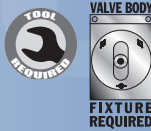

Helps cure:

- TCC apply/release concerns
- Low cooler flow

Note: Requires tool kit F-124740-TL14
& the VB-FIX reaming fixture.

3 124740-16 Isolator Valve Spring

5/Bag

Helps cure:

- No/Low line pressure
- Line pressure instability

4 124740-03K Isolator Valve Kit

Helps cure:


- No/Low line pressure
- Line pressure instability

5 124740-28K Pressure Switch Repair Kit

Fits 4 locations

Helps cure:

- Codes 0752, 0872, 0877, 098
- Shift concerns

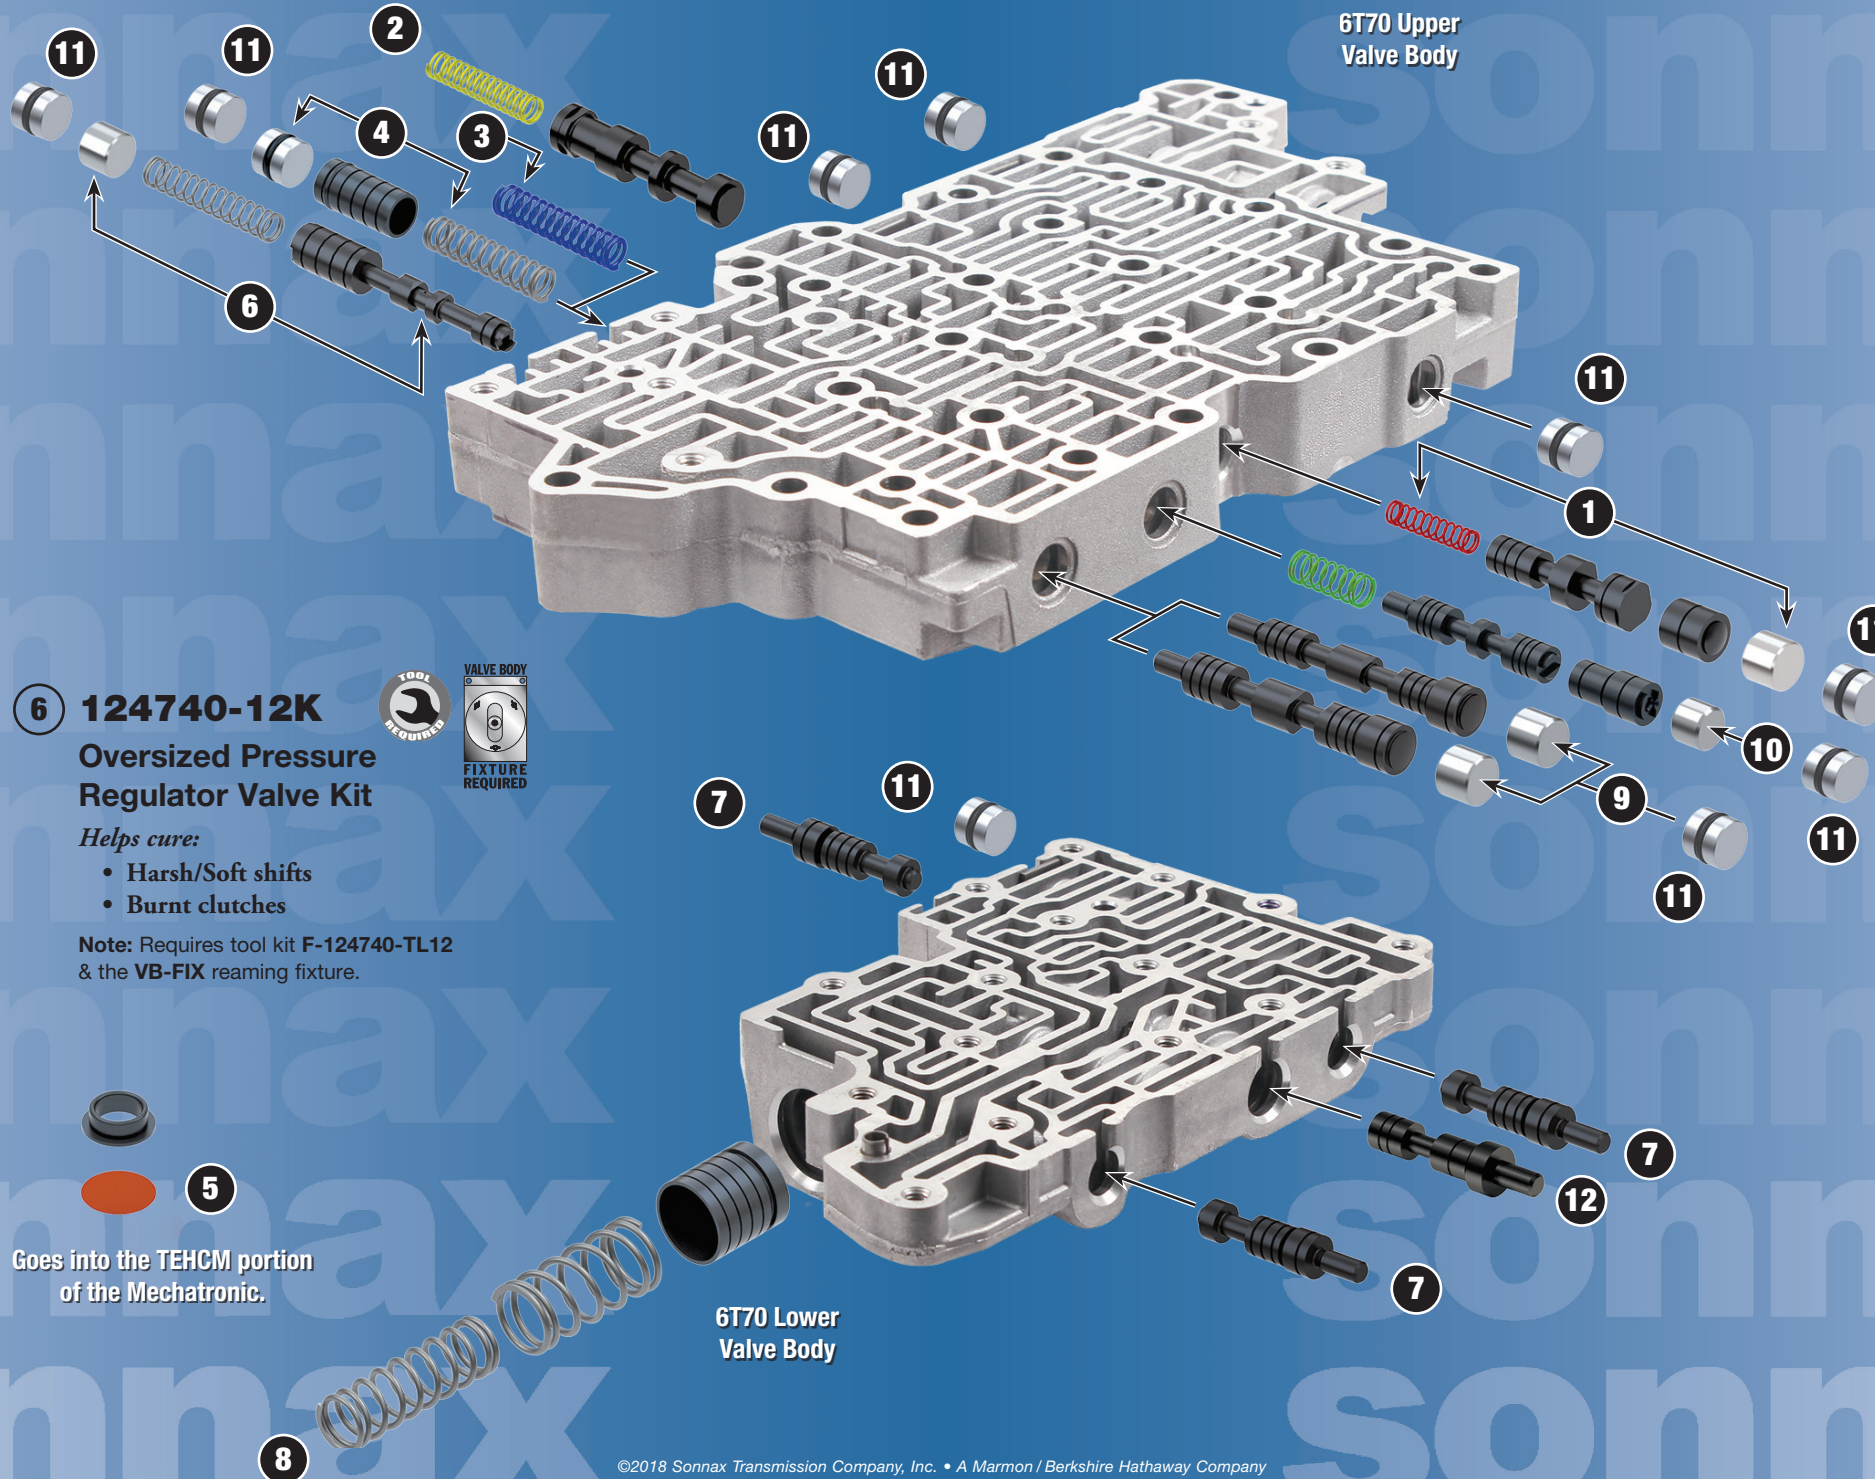

Goes into the TEHCM portion
of the Mechatronic.

6T70 Lower
Valve Body

6T70 Upper
Valve Body

7 144740-23 Oversized Clutch Boost Valve



Fits any of 3 locations

Helps cure:

- Slips & flares
- Burnt clutches

Note: Requires tool kit F-144740-TL22
& the VB-FIX reaming fixture.

8 124740-04K 4-5-6 Accumulator Piston Kit

Helps cure:

- Burned 4-5-6 clutch
- 4-5 Harsh/Flare

9 124740-21K 124740-26K

1.83 Ratio

1.35 Ratio

Oversized 3-5-R Clutch Regulator Valve Kits



Helps cure:

- 3rd & 5th Gear shift concerns
- Burnt 3-5-R Clutch

Note: 124740-21K requires tool kit F-124740-TL21,
124740-26K requires tool kit F-124740-TL26 & they
both require the VB-FIX reaming fixture.

10 124740-17K Oversized 2-6 Clutch Regulator Valve Kit



Helps cure:

- 2nd & 6th Gear shift concerns
- Burnt 2-6 clutch

Note: Requires tool kit F-124740-TL17
& the VB-FIX reaming fixture.

124740-02K O-Ringed End Plug Kit

Fits 9 locations

Helps cure:

- Shift concerns
- Burnt clutches

124740-01 Oversized AFL/Solenoid Regulator Valve



Helps cure:

- Solenoid codes
- Wrong gear starts

Note: Requires tool kit F-104740-TL12
& the VB-FIX reaming fixture.