

# Mercedes 722.9


# sonnax®

TIME TESTED • INDUSTRY TRUSTED®

1 Automatic Drive • P.O. Box 440 • Bellows Falls, VT 05101-0440 USA  
(800) 843-2600 • (802) 463-9722 • F: (802) 463-4059 • www.sonnax.com

Click on Sonnax part numbers to see more information.

## 1 88740-09K Oversized Lubrication Pressure Regulator Valve Kit

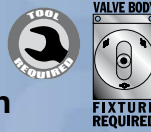

*Helps cure:*

- Low cooler & lube pressure
- Harsh TCC apply & release
- Erratic TCC apply pressure

**Note:** Requires tool kit **F-88740-TL9** & the **VB-FIX** reaming fixture.

## 2 88740-01 Oversized Working Pressure Regulator Valve




Replaces both early- and late-style OE valves.

*Helps cure:*

- Erratic line pressure
- Poor shift quality
- Burnt clutches

**Note:** Requires tool kit **F-88740-TL** & the **VB-FIX** reaming fixture.

## 3 88740-08 Oversized K1 Regulator Valve

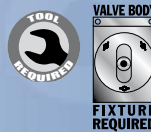


*Helps cure:*

- Bump shifts
- 2-3 Flare/Harsh
- 5-6 Flare/Harsh

**Note:** Requires tool kit **F-88740-TL8** & the **VB-FIX** reaming fixture.


## 4 88740-04K Oversized B2/BR Regulator Valve Kit

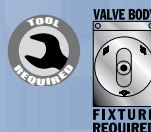

*Helps cure:*

- Harsh engagement
- Delayed Forward & Reverse
- 4-5 Flare/Harsh

**Note:** Requires tool kit **F-88740-TL4** & the **VB-FIX** reaming fixture.

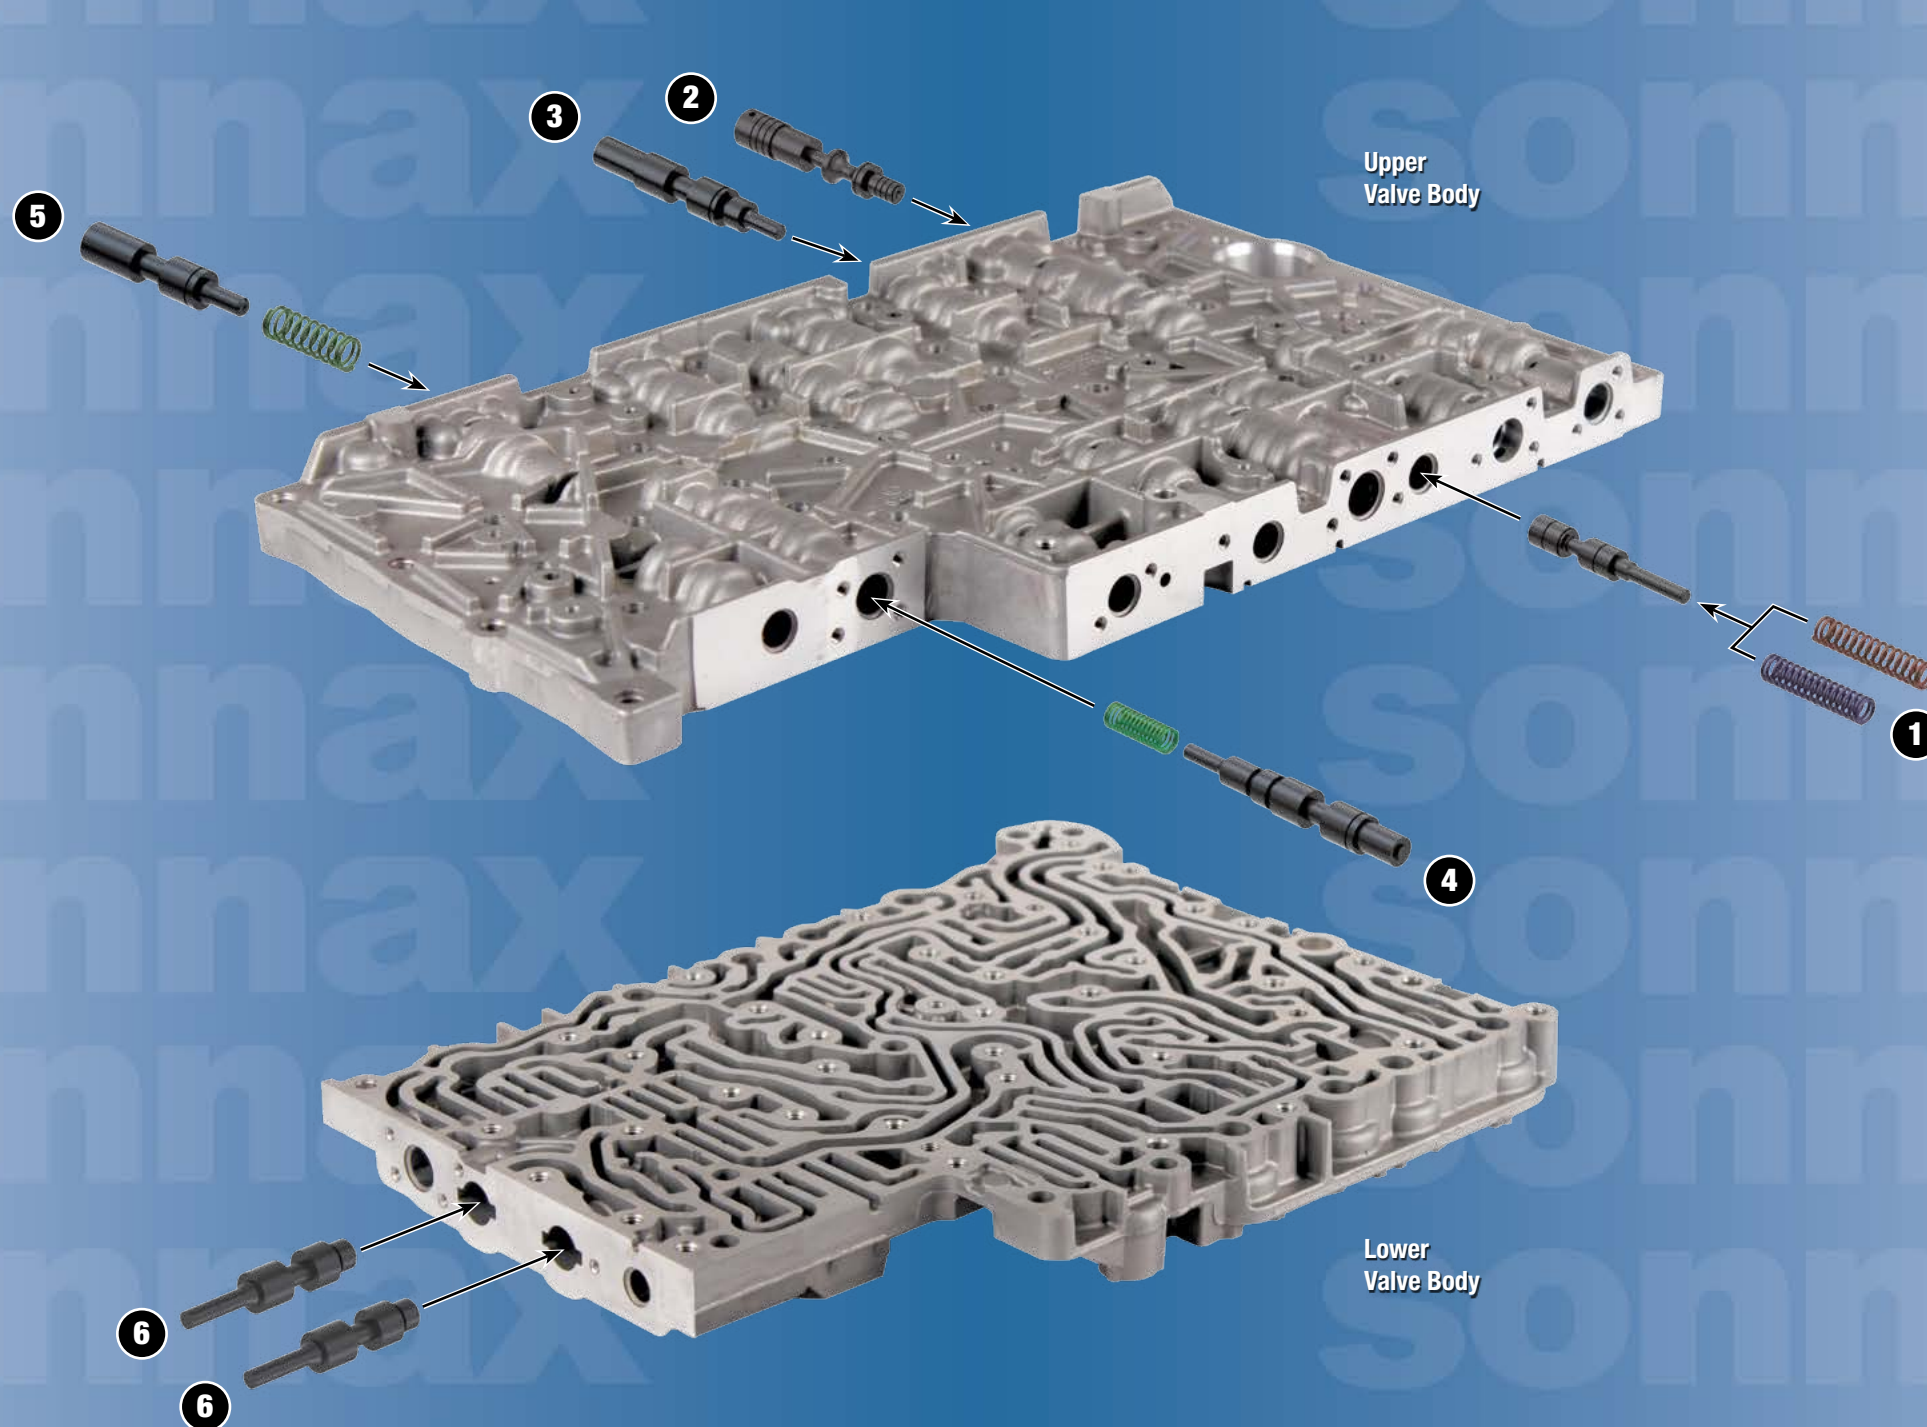

## 5 88740-06K Oversized K3 Shift Valve Kit




*Helps cure:*

- K3 clutch burned
- 4-5 Flare/Harsh
- No Forward

**Note:** Requires tool kit **F-46892-TL3\*** & the **VB-FIX** reaming fixture (tool kit also installs oversized solenoid pressure regulator or converter relief valve **46892-03**).

## 6 88740-02 Oversized Solenoid Regulator Valve

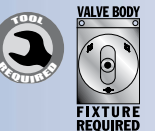

*Helps cure:*

- Solenoid codes
- Wrong gear starts
- Burnt clutches

**Note:** Requires tool kit **F-88740-TL2** & the **VB-FIX** reaming fixture.

Fits either of  
2 locations.