

Toyota U140E/F, U240E, U241E

sonnax®

TIME TESTED • INDUSTRY TRUSTED®

1 Automatic Drive • P.O. Box 440 • Bellows Falls, VT 05101-0440 USA
(800) 843-2600 • (802) 463-9722 • F: (802) 463-4059 • www.sonnax.com



This Sonnax kit also is available, see www.sonnax.com for details.

Zip Kit®
U140E-U241E-ZIP

1 57917E-03K* Lockup Control Plunger Valve Kit

Helps cure:

- TCC apply & release concerns
- TCC codes
- Burnt converters




2 27741-25K* Oversized Lockup Control Valve Kit

Helps cure:

- TCC apply & release concerns
- TCC codes
- Burnt converter

Note: Requires tool kit F-27741-TL25 & the VB-FIX reaming fixture.

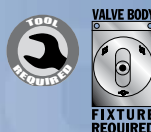

3 57917E-16K* Oversized Secondary Pressure Regulator Valve Kit

Helps cure:

- TCC apply & release concerns
- Harsh lockup
- Burnt converter

Note: Requires tool kit F-57917E-TL16 & the VB-FIX reaming fixture.




4 57917E-08K Oversized Pressure Regulator & Boost Valve Kit

Helps cure:

- Low/High line pressure
- Soft/Harsh shifts
- Clutch & band failures

Note: Requires tool kit 57917E-TL8.

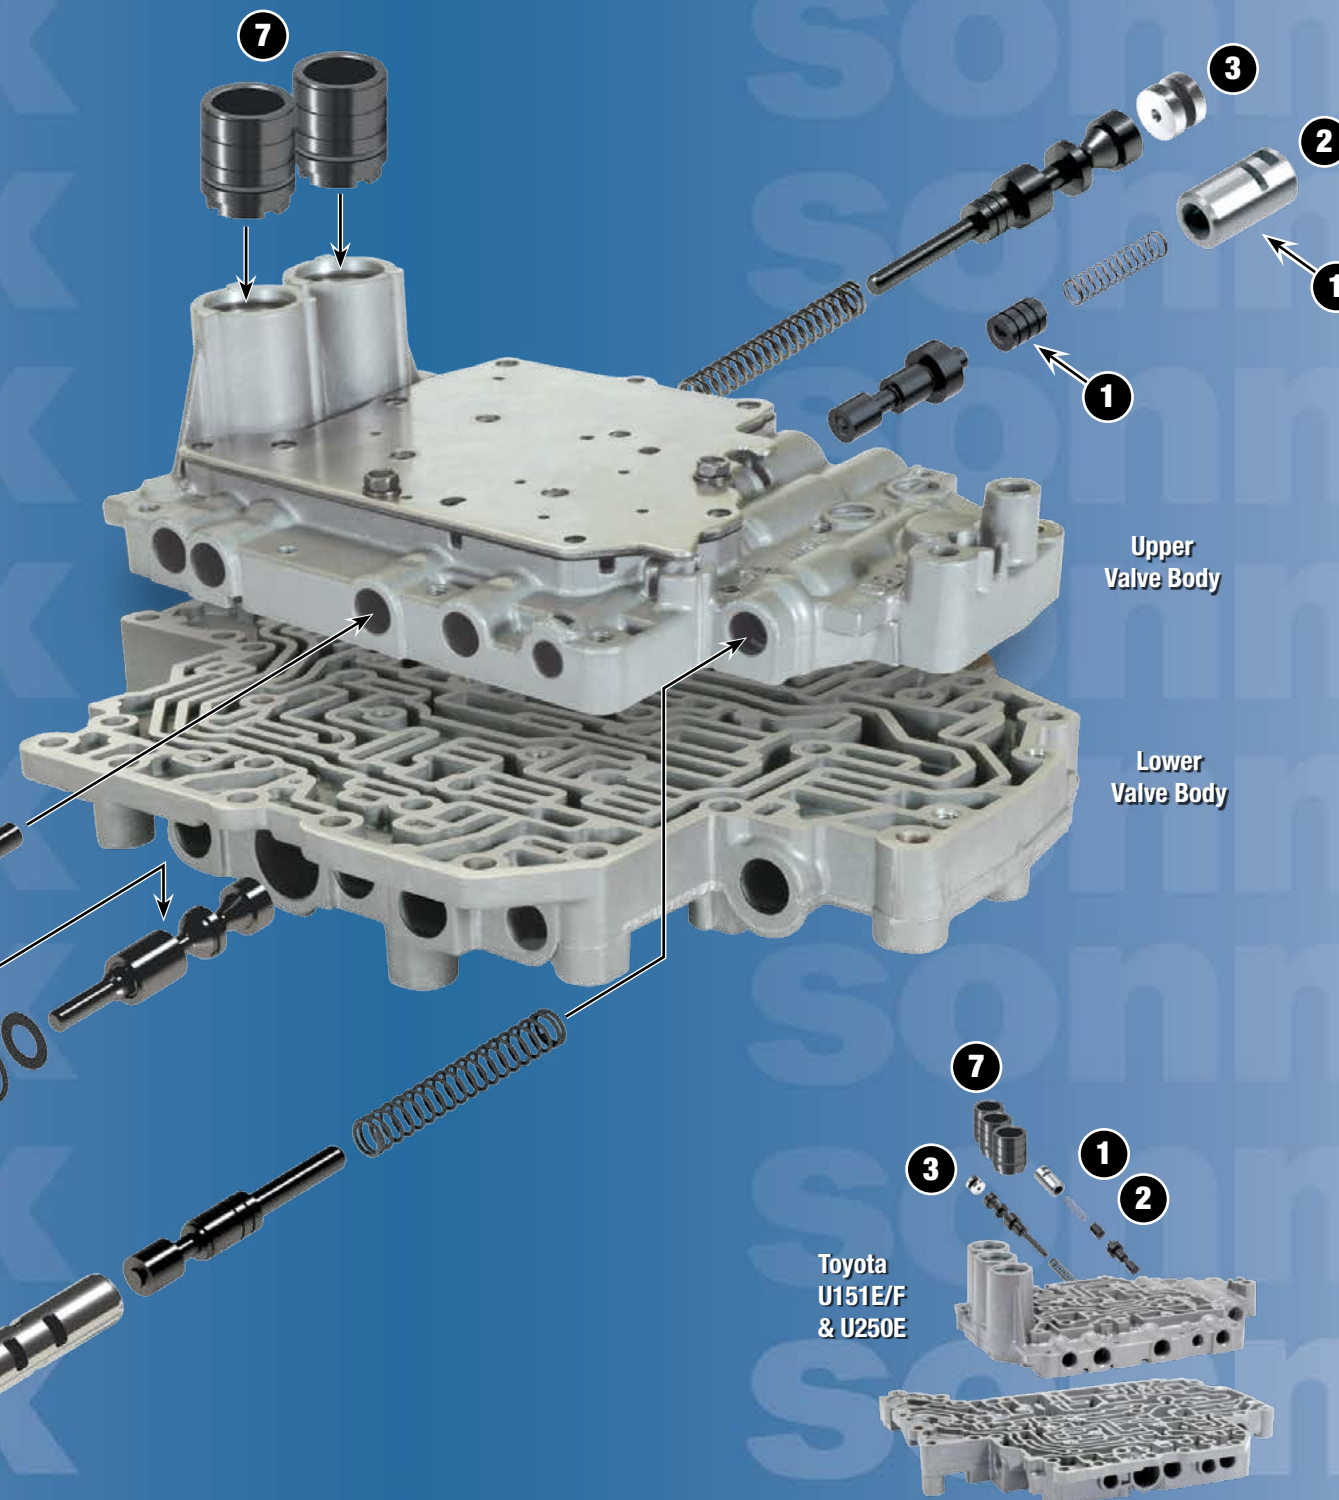

5 57917E-01K Boost Valve Kit

Helps cure:

- Low line rise in Drive
- High line pressure in Reverse
- Soft shifts

6 57917E-13K Oversized Solenoid Modulator Valve Kit

Helps cure:

- Harsh/Flare upshifts
- TCC slip/cycling
- Low cooler flow/overheating

Note: Requires tool kit F-57917E-TL13 & the VB-FIX reaming fixture.



7 57917E-19K* Accumulator Piston Kit

Fits Either of
2 Locations

Helps cure:

- Delayed engagement
- Flare shifts
- Burnt clutches

8 57917E-20K* O-Ringed End Plug Kit

Fits 9 Locations

Helps cure:

- Inconsistent shift quality
- Slips, flares, bumps, bangs and/or codes
- Clutch failure

9 57917E-05K Clutch Apply Control Plunger Valve Kit

Helps cure:

- Clutch failure
- Burnt clutches
- Shift concerns

*Note: These parts also fit Toyota U151E/F & U250E units.