

VW/Audi
01J

sonnax[®]

TIME TESTED • INDUSTRY TRUSTED[®]

1 Automatic Drive • P.O. Box 440 • Bellows Falls, VT 05101-0440 USA
(800) 843-2600 • (802) 463-9722 • F: (802) 463-4059 • www.sonnax.com

Click on Sonnax part numbers to see more information.

Pump
Assembly


1 **33741B-04K***

**Oversized Volumetric
Flow Rate Kit**

Helps cure:

- Chatter on acceleration
- Chain & sheave (pulley) surface damage

Note: Requires tool kit F-33741B-TL4 & the VB-FIX reaming fixture.

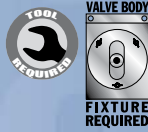


2 **33741B-08K***

**Oversized UV
Reduction Valve Kit**

Helps cure:

- Chatter on acceleration
- Ratio errors

Note: Requires tool kit F-33741B-TL8 & the VB-FIX reaming fixture.

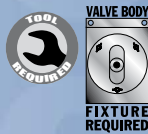


3 **33741B-10***

UV Adjustable End Plug

Helps cure:

- Chatter on acceleration
- Sluggish acceleration

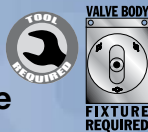


4 **33741B-01***

Oversized Safety Valve

Helps cure:

- Delay/Harsh forward engagement
- Chatter on forward engagement

Note: Requires tool kit F-33741B-TL1 & the VB-FIX reaming fixture.

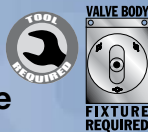

5 **33741B-06**

**Oversized VSTV Pilot
Pressure Valve**

Helps cure:

- Unstable solenoid pressure
- Delayed engagement
- Chatter on acceleration

Note: Both valves require tool kit F-33741B-TL6 & the VB-FIX reaming fixture.




6 **33741B-03K**

**Oversized
Clutch Control
(KSV) Valve Kit**

Helps cure:

- Clutch chatter on Forward or Reverse engagement
- Clutch friction failure & overheat

Note: Both kits require tool kit F-33741B-TL2 & the VB-FIX reaming fixture.

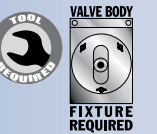

*NOTE: Fits 01J and 01T units.