




Important Technical Information...

Important Technical Information...



AW55-50 Pressure Tap Locations

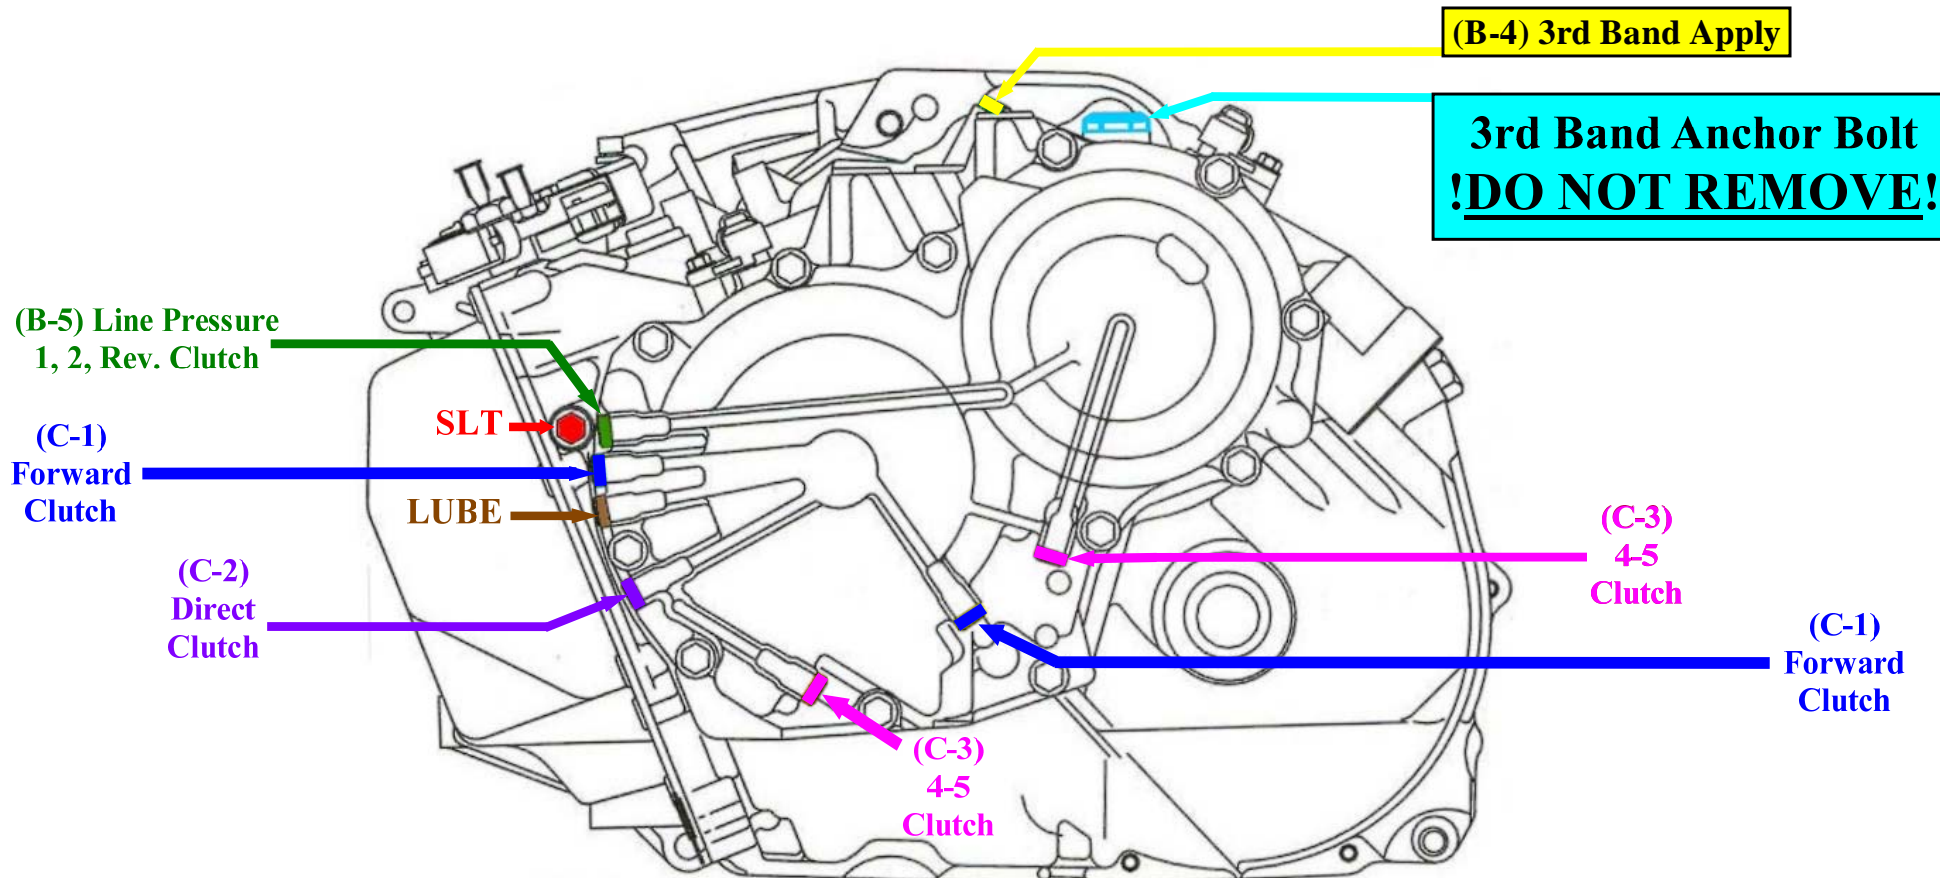

All Pressures Are P.S.I.

Test For Line Pressure at
(B-5), 1, 2, Rev Pressure Tap

	IDLE	WOT - Stall
DRIVE	48 - 57	186 - 202
REVERSE	73 - 88	247 - 287

1-866-2GET-VBX

"We Build Them So You Don't Have To."

www.valvebodyxpress.com