

COMPLAINT

SECONDARY COMPLAINTS

Delayed engagement

- No engine braking in manual 2nd.
- Low line pressure in R, N, D

CAUSE

Case bore wear and oil loss at the intermediate servo.

CORRECTION

This drop-in sleeve and piston salvages the case, and eliminates the complaints caused by oil loss.

Intermediate Servo Piston & Sleeve Kit


35709-01K

1 Servo Piston
1 Sleeve
1 Teflon® Seal

Also available:

35709-SK

10 Teflon® Replacement Seals

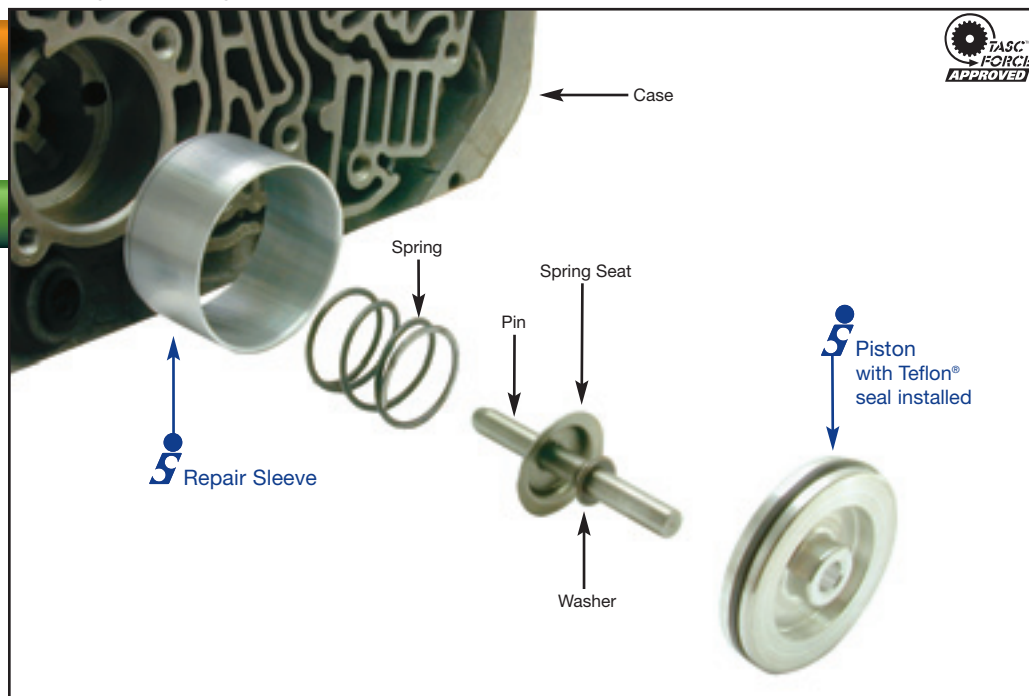

Sonnax Part Summary

The intermediate servo bore becomes scored from repeated cycling. The spring side of the piston has line pressure present in R, N, D. Excess leakage at the servo piston results in low line pressure and delayed engagements. During forward speeds, oil loss affects shift quality and reduces clutch life. To salvage cases install Sonnax Intermediate Servo Sleeve Kit **35709-01K**.

Features & Benefits:

- Kit contains an aluminum sleeve and a replacement piston with a Teflon® seal.
- This kit is a simple drop-in solution and requires no machining of the transmission case.

Save

Up to \$300 in case replacement costs